



(19)

Europäisches Patentamt

European Patent Office

Office européen des brevets



(11)

EP 0 600 146 B1

(12)

EUROPEAN PATENT SPECIFICATION

(45) Date of publication and mention

of the grant of the patent:

14.11.2001 Bulletin 2001/46

(51) Int Cl.7: G05B 19/418

(21) Application number: 93103561.2

(22) Date of filing: 05.03.1993

(54) Versatile production system and methods for operating same

Vielseitig verwendbares Produktionssystem und Verfahren zu dessen Gebrauch

Système de production versatile et méthode pour sa mise en oeuvre

(84) Designated Contracting States:
DE ES GB

(30) Priority: 30.11.1992 JP 31979592
30.11.1992 JP 31979892

(43) Date of publication of application:
08.06.1994 Bulletin 1994/23

(60) Divisional application:
98104129.6 / 0 859 299

(73) Proprietor: PFU LIMITED
Kahoku-gun Ishikawa 929-1192 (JP)

(72) Inventors:

- Saka, Nobuo
Kanazawa-shi, Ishikawa (JP)
- Oda, Junichi
Kahoku-gun, Ishikawa (JP)
- Kajihara, Kazuyuki
Hakui-gun, Ishikawa (JP)
- Ishiyama, Yasuaki
Kohoku-gun, Ishikawa (JP)

(74) Representative: Cohausz & Florack
Patentanwälte
Postfach 33 02 29
40435 Düsseldorf (DE)

(56) References cited:

EP-A- 0 417 297 EP-A- 0 448 327
GB-A- 2 194 086 GB-A- 2 219 109

- 1991 IEEE INTERNATIONAL SYMPOSIUM ON INTELLIGENT CONTROL PROCEEDINGS ,13-15 AUGUST, 1991, U.S.A. pages 134 - 139 L.E. HOLLOWAY ET AL 'INTEGRATION OF BEHAVIORAL FAULT-DETECTION MODELS AND AN INTELLIGENT REACTIVE SCHEDULER'
- ZWF ZEITSCHRIFT FÜR WIRTSCHAFTLICHE FERTIGUNG UND AUTOMATISIERUNG vol. 87, no. 10 , October 1992 , MUNCHEN DE pages 571 - 573 K. BRANKRAMP 'DER WERKER IM MITTELPUNKT'
- PROCEEDINGS OF THE INDUSTRIAL COMPUTING CONFERENCE vol. 1 27-31 OCTOBER, 1991, , U.S.A. pages 421 - 434 SHARI L.S. WORTHINGTON 'THE PERSONALIZATION OF MANUFACTURING: REDEFINING THE HUMAN INTERFACE'
- PROCEEDINGS 1992 IEEE INTERNATIONAL CONFERENCE ON ROBOTICS AND AUTOMATION 12-14 MAY, 1992, NICE, FRANCE pages 1179 - 1184 SHI-CHUNG CHANG & DA-YIN LAO 'SCHEDULING FLEXIBLE FLOW SHOPS WITH NO SETUP EFFECTS'

EP 0 600 146 B1

Note: Within nine months from the publication of the mention of the grant of the European patent, any person may give notice to the European Patent Office of opposition to the European patent granted. Notice of opposition shall be filed in a written reasoned statement. It shall not be deemed to have been filed until the opposition fee has been paid. (Art. 99(1) European Patent Convention).

Description**BACKGROUND OF THE INVENTION**

5 [0001] The present invention relates to a versatile production system and methods for operating the system. The system manufactures various kinds of products, including small quantities, on a single production line. The present system particularly relates to methods for operating the system by monitoring the running conditions of the production line and automatically generating work order sheets so as to increase productivity by minimizing tact-time of the production line. A relevant production planning system is disclosed by document GB A 2 219 109.

10 [0002] In general, in a production line for manufacturing products, necessary parts for assembling the products are supplied; the products are assembled, tested and inspected and the performance of the assembled products are approved as a result of the test and are conveyed to a packing site. It is preferable for mass production to install a production line for each product, and when various item products are manufactured, including small quantities, a large factory space and a large number of production facilities are required. When products are manufactured in small quantities having a separate production line for each product, idle time increases, and sections of occupied factory space, production facilities, and operators become redundant.

15 [0003] In order to solve these problems, an applicant of the present invention developed inventions previously filed at the Japanese Patent Office, entitled "Versatile Production System". According to this system, a production system is provided that manufactures various kinds of products, including small quantities, and in the system, work order sheets required for each process and information pertaining to defective parts found in the preceding processes on the line are automatically provided, and the system automatically produces a test result report before conveying the products to a packing site.

20 [0004] In such a production system, there are three aspects that should be considered to improve productivity. The first aspect is described hereinafter. In the production line, tact time, which is consumption time for executing each process such as product assembling, testing and inspection is different depending on the work efficiency or health conditions of each operator. The tact time changes depending on each operator's working time, because the work efficiency changes depending on each operator's working time.

25 [0005] The second aspect is that continual production proceeds without knowing the manufacturing condition of defective products, which depends on missing parts and defective units found in the assembled and tested products.

30 [0006] When continual production proceeds without knowledge of the preceding processes, that is if abnormal conditions occur, productivity deteriorates significantly. While if the continual production proceeds without knowing the percentage of defective products, a significant number of defective products are potentially manufactured.

35 [0007] The third aspect is described below. In the production line, consumption time for executing each process such as assembling, testing and inspecting is different so that tact time, which is the maximum consumption time for executing each process, is preferably minimized, whereby each operator does not have excess time between each process. In order to minimize tact time, work order sheets are occasionally prepared for each operator at each working site, which are prepared by trial and error based on manual calculations when work is assigned to operators at each work site. Production then proceeds in accordance with the work order sheets.

40 [0008] However, the work order sheets obtained above are usually inappropriate, thereby providing operators with idle time and reducing productivity. In addition, preparation of the work order sheets requires time and labor, thereby preventing the work order sheets from being prepared on time when work order changes are required from the production control system.

SUMMARY OF THE INVENTION

45 [0009] The invention concerns a versatile production system and a method of operating a versatile production system, as defined by claims 1 and 8 respectively.

[0010] The object of the present invention, which solves the foregoing problems, is to provide a versatile production system and operating methods that have a monitoring function showing running conditions of the line, such as the work efficiency of each operator for each process and the current percentage of defective products, and that rapidly output appropriate work order sheets to each operator after determining a failure on the production line.

50 [0011] Fig. 1 is a basic construction drawing of a versatile production system of the present invention. The versatile production system of the present invention, which achieves the first object, comprising:

55 at least one assembling site 1 for assembling parts delivered in order and making various kinds of products on a single production line;

at least one testing site 2 for testing and inspecting the performance or quality of assembled products;

a plurality of line terminals 3 installed at any of the assembling sites or the testing sites;

a communication-memory unit 4 attached to a product or a pallet for loading the product so as to match the flow of products and information and that communicates manufacturing data with the line terminals and memories when the pallet is conveyed to the production line;

5 a line host controller 5 reads the memorized data from the communication-memory unit via the line terminals installed in the work places of the assembling sites and the testing sites, and uses the read data to output work order sheets for operators working at the assembling sites and the testing sites via the line terminals;

10 a line host control terminal 6 that directly inputs and outputs data for master file maintenance, including work order control, progress control, schedule arrangement and machine history related data with the line host controller; and a fault product information terminal 7 that inputs fault code data showing the contents of faults for fault products that should be replaced, and deletes the fault code data after repairing the fault by replacing the fault parts.

[0012] The versatile production system includes the line host controller that monitors parameters such as time control, quality conditions and states of operators for running conditions of said versatile production line, compares the parameter data with a caution level threshold value and displays a caution notice when the parameter data is larger than the caution threshold value through the line terminals or the line host control terminal.

[0013] The versatile production system includes the line host controller that monitors parameters such as time control, quality conditions and states of operators for running conditions of said production line, compares the parameter data with a hazard level threshold value and displays a hazard notice when the parameter data is larger than the danger threshold value through the line terminal or the line host control terminal, and outputs work orders for rearranging the production line.

[0014] The versatile production system includes the line host controller that monitors parameters such as time control, quality conditions and states of operators for running conditions of the production line, compares the parameter data with a critical fault level threshold value and stops the production line, displays and outputs work orders for operators, thereby providing next work operations through the line terminals or the line host control terminal when the parameter data is larger than the critical threshold value.

[0015] In the versatile production system the parameter related time control is calculated after communication with the line host controller via the line terminals concerning the memorized data in the communication-memory unit.

[0016] In the versatile production system the parameter related quality conditions are calculated from data communicated with the line host controller via the line terminals or the fault product information terminal.

[0017] In the versatile production system, the parameters related to states of operators are calculated from sensor signals, which are installed in the workplaces for operators and electrically connected to a programmable controller and the sensor signals are transmitted to the line host controller via the line terminal.

[0018] A method for operating a versatile production system comprises:

35 a step 1 that monitors parameters such as time control, quality conditions and state of operators for running conditions of the production line;

a step 2 that compares the parameter data with a caution level threshold value; and

a step 3 that displays a caution notice when the parameter data is larger than the caution threshold value through the line terminals or the host control terminal.

40 [0019] A method for operating a versatile production system comprises:

a step 1 that monitors parameters such as time control, quality conditions and states of operators for running conditions of the production line, compares the parameter data with a hazard level threshold value;

45 a step 2 that displays a hazard notice when the parameter data is larger than the danger threshold value through the line terminal or the line host control terminal; and

a step 3 that outputs work orders for rearranging the production line.

[0020] In the method for operating a versatile production system, the production line is rearranged by means of changing the work man-hours for each operator and the number of operators, and the work place changes depending on the operators' rating.

[0021] A method for operating a versatile production system comprises:

55 a step 1 that monitors parameters such as time control, quality conditions and states of operators for running conditions of the production line;

a step 2 that compares the parameter data with a critical fault level threshold value;

a step 3 that stops the production line; and

a step 4 that displays and outputs work orders for operators, thereby providing next work operations through the

line terminals or the line host control terminal when the parameter data is larger than the critical threshold value.

[0022] A versatile production system which achieves the aforementioned second object comprises:

- 5 at least one of assembling sites 1 for assembling parts delivered in order and making various kinds of products on a single production line;
- at least one of testing sites 2 for testing and inspecting the performance or quality of assembled products;
- 10 a plurality of line terminals 3 installed at any of the assembling sites or the testing sites;
- a communication-memory unit 4 attached to a product or a pallet for loading the product so as to match the flow of products and information and that communicates manufacturing data with the line terminal and memorizes same when the pallet is conveyed to the production line;
- 15 a line host controller 5 reads the memorized data from the communication-memory unit via the line terminals installed in the workplace of the assembling sites and testing sites, and uses the read data to output work order sheets for operators working at the assembling sites and the testing site via the line terminals and outputs test result reports containing test/inspection record data for a product that has been assembled, tested and inspected and finally determined as defective free products via a line terminal installed at a final testing site; and
- 20 a line host control terminal 6 that directly inputs and outputs data for master file maintenance, work order control, progress control, schedule arrangement and product history related data with the line host controller:

20 wherein the line host controller 6 is characterized in that it previously memorizes; each file such as work contents, operators, time changes standard parts feeding sequence, components of a product and maintenance tools; receives a production command from the production control system; calculates and shares work so as to minimize the tact; and outputs the work order sheets via the line terminal.

[0023] A versatile production system further comprises a fault information terminal 7 that inputs fault content data for products having faulty parts to be replaced, inputs faulty parts data that indicates parts are defective, and deletes the faulty input data after repair by replacing the faulty parts.

[0024] In the versatile production system, the line host controller outputs work order sheets to minimize the tact via the line terminal;

30 the work order sheet is generated from a schedule file that records the work start date, type code, product name, product number, work sequence and work start time for a determined process, and a process base work file that indicates which product should be produced, and indicates when and what time the work should be started, and what work should be executed based on each process.

[0025] A method for operating a versatile production system so as to minimize the tact comprises:

35 a first step to calculate an average value by dividing the total work man-hours that is the sum of man-hours required by each work for making a predetermined product by a process number corresponding to an operator number; a second step to multiply each group sum of work man-hours for work assigned to each operator by each rating; namely, a work efficiency factor for each operator so as to render the work man-hours for each process equal or less than the average value.

40 [0026] A method for operating a versatile production system so as to minimize the tact comprises:

45 a first step to determine the intended assigned man-hours of each operator by dividing the sum of the total work man-hours by the sum of the rating of each operator and multiplying the operator rating; a second step to assign works to each operator so as to render the work man-hours for each process equal or less than the intended assigned man-hours.

[0027] A method for operating a versatile production system so as to minimize the tact comprises:

50 a third step that assigns remaining work that was not assigned to each operator so as to obtain the total work man-hours for each operator by adding the group sum of work man-hours for each operator, which become substantially equal between operators.

BRIEF DESCRIPTION OF THE DRAWINGS

55 [0028]

Fig. 1 is a basic construction drawing of a versatile production system of the present invention;

Fig. 2 shows an embodiment of a versatile production of the present invention;

Fig. 3 shows hardware for linking between an ID card unit and a line host controller;
 Fig. 4 shows a format of an ID card;
 Fig. 5 is a flow chart for a monitoring process of a versatile production system of the present invention;
 Fig. 6 is a table example showing a calculation process of a production line balance considered as most appropriate before modification;
 Fig. 7 is a table example showing a calculating process of a production line balance considered as most appropriate after modification;
 Fig. 8A is a half part of a table example for a work contents file stored in a memory area of a line host controller;
 Fig. 8B is another half part of a table example for a work contents file stored in a memory area of a line host controller;
 Fig. 9A is a table example for an operator file stored in a memory area of a line host controller;
 Fig. 9B is a table example for a highly efficient working time zone file stored in a memory area of a line host controller;
 Fig. 9C is a table example for a normal production sequence file stored in a memory area of a line host controller;
 Fig. 10A is a table example for a maintenance tool file stored in a memory area of a line host controller;
 Fig. 10B is a table example for a parts list file stored in a memory area of a line host controller;
 Fig. 10C is a table example for a production command file stored in a memory area of a line host controller;
 Fig. 11A is a table example of a process base file stored in a memory area of a line host controller;
 Fig. 11B is a table example of a schedule file stored in a memory area of a line host controller;
 Fig. 12 is a first part of a process flow chart for generating a work order sheet arranging an appropriate production line balance;
 Fig. 13 is a second part of the flow chart continuing to Fig. 12;
 Fig. 14 is a last part of the flow chart continuing to Fig. 13;
 Fig. 15 is a table example showing a first calculation process of a production line balance considered most appropriate;
 Fig. 16 is a table example showing a second calculation process of a production line balance considered most appropriate;
 Fig. 17A is a half part of a collection of display examples of work order sheets;
 Fig. 17B is another half part of a collection of display examples of work order sheets;
 Fig. 18A is a display example when fault unit data is input;
 Fig. 18B is a display example when product error code are input;
 Fig. 19A is a display example of a units list for a product before replacing faulty units;
 Fig. 19B is a display example of a unit list for a product after replacing faulty units.

DESCRIPTION OF THE PREFERRED EMBODIMENTS

[0029] Fig. 2 shows an embodiment of a versatile production system of the present invention. In Fig. 2, M1 to M6 denote assembly sites for assembling products. T1 to T14 denote testing sites for testing and inspecting semi-assembled products. A semi-assembled product implies an integrated body of parts making up a product, which is then transported during the assembling process, from assembly to completion of assembly, to the first testing site T1. In the assembling sites M1 to M6, semi-assembled products 1 to 6 are assembled. The assembling sites M1 to M6 include temporary parts supply stations (not shown), in which parts required for the type of product are stored. Trolleys are used to distribute parts, each of which distributes parts to the assembling sites M1 to M6 in the order in which the parts are assembled. Some assembling sites may not be used depending on the number of parts. For example, if assembling is completed by using assembling site M1 to M4, then assembling site M5 and M6 are not used. In this embodiment, an ID card (not shown) serving as a communication-memory unit or a data carrier is attached to a pallet for loading a product. The ID card is used to transfer information necessary for manufacturing products to or from a line host controller via line terminals.

[0030] Fig. 3 shows hardware for linking between an ID card and a line host controller. In Fig. 3, a numeral 11 denotes what is referred to as an optical ID unit or an ID card in the present invention. The ID card 11 is attached to a product or a pallet for loading a product, and an optical terminal 12 is installed in each assembling site or each testing site. When the ID card arrives, a photoelectric switch installed in each assembling or testing site detects the presence of the ID card and a sequencer 14 stops a conveyor belt, which is not shown. The assembling or testing is then started. Beforehand, the ID card 11 is communicated via the optical terminal 12 to read or write data therefrom or thereon. Reading or writing data is effected by a line terminal 15 in each workplace under the control of a line host controller 16. A signal transferred via the optical terminal 12 is amplified by a control unit 13. The control unit 13 is connected through the sequencer 14 or directly to the line terminal 15 using an RS-232C interface.

[0031] A line terminal in an assembling site M1 transmits a products code corresponding to a product type that has been entered by a keyboard or by reading a bar code to a line host controller. The line host controller writes data for

an ID card, such as, a products code, a control number, a process number, a work start time, a work end time, and test patterns that are stored therein, on an ID card to be described later via a semi-assembled product handling terminal. The line host controller then informs an operator of the data for an ID card by outputting an assembling work order sheet to a CRT monitor or printer connected to the semi-assembled product handling terminal. The operator in the 5 assembling site M1 starts driving a transporting means or a conveyor belt (not shown) so as to transport an assembled product according to the work order sheet.

[0032] At assembling sites M2 to M6, semi-assembled product terminals or line terminals installed therein read the product code, control number, and other data from the ID card attached to the pallet transported sequentially to the workplaces. The semi-assembled product terminals also read data pertaining to the type, part numbers, lot numbers, 10 and the manufacturing dates of the parts making up the semi-assembled product, for example, from the bar codes attached to the parts. The semi-assembled product terminals then transmit the read data to the line host controller. The line host controller informs operators of the above data by outputting the assembly work order sheets associated with the assembling sites M2 to M6, which will be stored in the line host controller, to CRT monitors or printers connected to the respective semi-assembled product terminals. The operators start driving transporting means or conveyor belts 15 (not shown) to feed semi-assembled products 1 to 6, which are being assembled, to the assembling sites at the subsequent steps. Finally, the semi-assembled product 6 is transported to a testing site T1.

[0033] A testing terminal or a line terminal in the testing site T1 reads the products code and the control number from the ID card attached to the transported pallet and identifies the type, part numbers, lot numbers, and manufacturing 20 dates of the parts making up the product by reading, for example, bar codes attached to the parts. The testing terminal then transmits these data to the line host controller. The line host controller determines whether any part is missing from the semi-assembled product 6, then issues a work order indicating, for example, Missing Part Found to a CRT monitor or a printer connected to the testing terminal, thus informing the operator. Moreover, the testing terminal writes the data acquired in the testing site T1, which includes a process number, a work start time, a work end time, and the 25 results of determination indicating the presence or absence of a defect, on the ID card. The operator then starts driving a transporting means or a conveyor belt (not shown) to feed the semi-assembled product 6 to a testing site T2.

[0034] A line terminal in the testing site T2 reads the data of products code and the control number from the ID card attached to the transported pallet, then transmits these data to the line host controller. The line host controller checks 30 and determines whether Software Keep should be executed; that is, if a test program should be written in the hard disk of the product, and then informs an operator of the results of the check by outputting the result to a CRT monitor or a printer connected to the line terminal. When it is determined that Software Keep should not be executed, the operator starts transporting the semi-assembled product to a testing site T3 at the next step, and when it is determined that Software Keep should be executed, the operator temporarily places the semi-assembled product on a Software Keep shelf, writes a test program on the hard disk of the product, and starts transporting the semi-assembled product to the 35 testing site T3 at the next step.

[0035] A line terminal at the testing site T3 reads the data of products code and the control number from the ID card attached to the transported pallet, and then transmits the read data to the line host controller. The line host controller checks to determine if the semi-assembled product 6 should be retired (i.e. subjected, as a returned article, to a repairing 40 process), then informs an operator of the result of the check by outputting same to a CRT monitor or a printer connected to the line terminal. When it is determined that the semi-assembled product should be retired, the operator places the semi-assembled product 6 at a retiring site. When it is determined that the semi-assembled product should not be retired, the operator checks a setting order indicating the conditions for setting high-temperature aging and low-temperature 45 aging apparatuses, then sets the aging apparatuses according to the setting order. In the setting, the operator sets the aging time, relative to a set aging voltage to, for example, two hours at a voltage L (a little lower than 5V) or twelve hours at a voltage VH (a little higher than 5V), and specifies the number of steps occupied by each aging apparatus that depends on the size, or especially, the height of a semi-assembled product. The operator then starts driving a transporting means inside the high-temperature aging apparatus toward a testing site T4 at the next step.

[0036] The number of occupied steps is set to six for each of the high-temperature aging and normal-temperature aging apparatuses. A transporting means covering six steps is installed, and depending on the height of a semi-assembled product, two or three steps are occupied for each semi-assembled product. The high-temperature aging 50 apparatus consists of transporting means for outgoing and incoming paths. The normal-temperature aging apparatus includes a transporting means for an outgoing path alone. A retiring site is preserved not only in testing site T3 but also in testing sites T4, T5, T7, and T14.

[0037] A line terminal in the testing site T4, which situated outside the outgoing path of the high-temperature aging apparatus, reads the data of the products code and the control number from the ID card attached to the transported 55 pallet, and then transports the read data to the line host controller. The line host controller outputs the received data to a CRT monitor or a printer connected to the line terminal, thus reporting whether or not the semi-assembled product 6 has an automatic voltage change function, and when the semi-assembled product 6 has said function, the operator does not respond and when the semi-assembled product 6 does not have said function the operator modifies the set

voltage value manually. The operator then starts driving a transporting means in the high-temperature aging apparatus to transport the semi-assembled product 6 through the outgoing path of the high-temperature aging apparatus toward a testing site 5 at the next step.

5 [0038] A line terminal in the testing site T5, which is situated outside the outgoing path of the high-temperature aging apparatus, reads the data of the products code and the control number from the ID card attached to the transported pallet, and then transmits the read data to the line host controller. The line host controller outputs the aging time for the normal-temperature (room-temperature) aging apparatus and the number of occupied steps for the semi-assembled product to a CRT monitor or a printer connected to the line terminal, thus informing an operator of the data. The operator sets the aging time for the normal-temperature aging apparatus and the number of occupied steps as informed, and then starts driving a transporting means in the normal-aging apparatus.

10 [0039] After normal-temperature aging is completed, the semi-assembled product is transported to a testing site T10. A line terminal in the testing site T10 reads the data of the products code and the control number from the ID card attached to the transported pallet, and then transports the read data to the line host controller. The line host controller outputs the received data to a CRT monitor or a printer connected to the line terminal, thus informing an operator whether Software Keep should be executed; that is, whether an operating system should be written. When Software Keep should be executed, the operator executes a write operation, and following that, the operator starts driving the transporting means to a packing site toward a testing site T14. When Software Keep should not be executed, the operator starts driving the transporting means without Software Keep.

15 [0040] A line terminal in the testing site T14 reads the data of the products code and the control number from the ID card attached to the transported pallet, and then transmits the read data to the line host controller. The line host controller issues a test result report to a printer connected to the line terminal at the testing site T14. Moreover, the line host controller executes Stocking After Testing; in other words, the line host controller reports the completion of assembly and inspection to a production management system. Furthermore, the line host controller communicates via a packing site host controller at a packing site over LAN, and informs an operator of a packing work order indicating that a 20 cardboard box required for packing should be prepared to transport a semi-assembled product to the packing site by outputting the packing work order to a printer or a CRT monitor connected to the administration terminal of the packing site host controller. On the other hand, the line terminal in the testing site T14 writes the data acquired in the testing site T14, which includes a process number, a work start time, a work end time, and the results of a determination representing the presence or absence of a defect, on the ID card. Finally, the operator starts driving a transporting means or a conveyor belt (not shown) so as to feed the product to the packing site.

25 [0041] Furthermore, in the vicinity of a workplace for repairing faulty products, a fault-in (information) terminal is provided. Through the fault-in terminal, data indicating faulty contents are input for the product in which at least one defective unit is found, defective parts data which are judged defective are input, and the faulty contents data or defective parts data are deleted when defective units or parts are replaced. In this way, quality control is executed.

30 [0042] A line host control terminal 6 is used when directly inputting or outputting the data relating to production management and quality control including master file maintenance, work order control, progress control, schedule arrangement, and product history control. The host controller 5 is called a floor controller because it is on the same floor as the production line. Furthermore, the line host controller 5 outputs work order sheets to minimize the tact via each line terminal.

35 [0043] Fig. 4 shows a format of an ID card. An ID card employed in the embodiment has a storage capacity of 2K bytes as shown in Fig. 4. A 32-byte memory area (herein, one byte consists of four bits) is allocated to each of the 22 addresses. In this memory map, data stored at address 1 are fixed data, a products code, a control number, data indicating the presence or absence of a defect, a line-out flag, a line-in flag, selection of VH or VL, line-out Process, Pallet Return, a re-entry flag, a No. 1 Keep flag, a No. 2 Keep flag, and Automatic Voltage Change of VN, VL, and VH. 40 Data stored at address 2 are a high-temperature VH aging time, a high-temperature VL aging time, a normal-temperature aging time, Step Change, and supplementary data related to line control. Data stored at addresses 3 to 8 are the process numbers, start times, the results of determination, end times, and supplementary data of semi-assembled products 1 (assembling site M1) to semi-assembled products 6 (assembling site M6). Data stored at addresses 9 to 45 10 are process numbers, start times, the results of determination, end times, and supplementary data of semi-assembled products from the beginning of the test process (at a testing site T1) to the end of the test process (at a testing site T14).

50 [0044] The contents of the memory will be described as a supplement. Fixed data represents a leading address of a memory area and is set to 0. The products code and the control number indicate a product type and a parts number respectively. The presence or absence of a defect indicates whether or not a part is missing or an abnormality is found in the results of a test. The line-out flag provides identification data indicating that a product should be neither assembled nor tested until a product, in which a defect is detected, reaches the first retiring space. The line-in flag specifies re-entry; that is, provides data indicating whether or not product is retired, or in which process a retiring order is issued. For example, 00 represents No Retired Product. 01 represents Retire Order issued in Process 1. Selection of VH or

VL indicates whether VH or VL is set to an automatic power change unit installed at a testing site T4. Line-out Process indicates a process in which a product is retired. Pallet Return is data indicating whether a pallet should be returned to a leading process by passing through or bypassing the high-temperature aging apparatus. The re-entry flag specifies whether or not the product is a re-entered article. The No. 1 Keep flag specified whether or not to load a test program.

5 The No. 2 Keep flag specifies whether or not to load an operating system on a hard disk. Automatic voltage Change of VN, VL, and VH indicates whether a product has an automatic voltage change function.

[0045] The high-temperature VH aging time, high-temperature VL aging time, and normal-temperature aging time, which reside at address 2, are provided, for example, as data 1230, meaning that aging continues for twelve and a half hours. Step Change indicates the selection of one step, two steps, or three steps. The process numbers residing 10 at addresses 3 to 22 are concerned with assembling sites M1 to M6 or testing sites T1 to T14. The start time or end time is written in the form of a date, hours, minutes, and seconds. The results of the determination indicate the presence or absence of a defect.

[0046] As described above, an ID card stores data of each product. As a semi-assembled product is transported 15 over a production line, the ID card is read and written at assembling and testing sites. Based on these data, up-to-date and accurate work orders are issued. Communication with a quality information system and a production management system enables the common use of data and offers support to quality control and production management systems.

[0047] Fig. 5 is a flow chart for a monitoring process of a versatile production system of the present invention. Before 20 explaining Fig. 5, parameters used for monitoring the versatile production system of the present invention will be explained. The parameters are divided into three main factors such as (A) time controls, (B) quality conditions and (C) state of operators.

[0048] According to (A), time control based parameters, there are three main parameters: tact time, line balance and 25 man-hours for each process that is input from line terminals. All of these parameters are calculated based on input data through the ID cards, in such a manner that the tact time is calculated from the time each semi-assembled product is passing the individual working site, the line balance is calculated from the time differences between the maximum tact time and the minimum tact time in each process, and the number of man-hours for each process is calculated by deducting the work start time from the work end time. There is another parameter according to (A), that is, operator unoccupied time, which is calculated from sensor input signals located at each working site so as to detect the existence of the operator.

[0049] According to (B), quality condition based parameters, there are several parameters pertaining to the frequency 30 of faulty products occurring based on types, processes, contents, parts and critical faults, which are calculated from input information mainly obtained through the faulty information terminal each time faulty products are found.

[0050] According to (C), the state of operator based parameters, there are three main parameters: stop hours at the 35 same location, remaining hours outside the normal working site, and frequency of moving from the working site, all of which report the status of the operator. These parameters are calculated from sensor input signals provided at each working site and electrically connected with programmable controllers, and are then communicated with the line host controller via each of the line terminals.

[0051] The threshold value table are explained hereinafter. In the embodiments of the present invention, a caution level and a hazard level are provided as threshold levels, and additional threshold levels may be provided if necessary.

[0052] The calculations of each parameter are explained below. Each parameter is defined as follows:

40

(A) Time controls

| | |
|---------------|---|
| T_{start} : | work start time of a process |
| T : | arriving time of a semi-assembled product (for nth product) |
| t_{s1} : | arriving time of a semi-assembled product (for (n+1)th product) |
| T_{end} : | work end time of a process |
| T_{out} : | product feeding time from a process |
| T_{tact} : | tact time of a process ($T_{tact} = T_{s1} - T_{s0}$) |
| T_{stop} : | work stop time ($T_{stop} = T_{out} - T_{end}$) |
| T_{kosu} : | working man-hour ($T_{kosu} = T_{start} - T_{end}$) |
| T_{bar} : | line balance [$T_{bar} = \text{MAX}(T_{tact}) - \text{MIN}(T_{tact})$], |

where T_{start} , T_{s0} , T_{s1} , T_{end} and T_{out} are direct input data received through the ID cards, and T_{tact} , T_{stop} , T_{kosu} and T_{bar} are calculated from the input data received through the ID cards.

55 (B) Quality conditions

| | |
|-----------------|---|
| $N_{in-\ell}$: | number of semi-assembled products fed in to the production line (counted at the first working site) |
| N_{in-k} : | number of semi-assembled products passed through each working site |

5 N_{err-d} : same product type faulty product number occurrence
 N_{err-k} : same process faulty product number occurrence
 N_{err-n} : same contents faulty product number occurrence
 N_{err-b} : same parts faulty product number occurrence
 O_{kisyu} : same type faulty product occurrence frequency

$$(Q_{kisyu} = (N_{err-d}/N_{in-\ell}) \times 100)$$

10 Q_{kotel} : same process faulty product occurrence frequency

$$(Q_{kotel} = (N_{err-k}/N_{in-k}) \times 100)$$

15 Q_{naiyo} : same contents faulty product occurrence frequency

$$(Q_{naiyo} = (N_{err-n}/N_{in-\ell}) \times 100)$$

20 Q_{buhin} : same parts faulty product occurrence frequency

$$(Q_{buhin} = (N_{err-b}/N_{in-\ell}) \times 100)$$

25 where $N_{in-\ell}$, N_{in-k} , N_{err-d} , N_{err-n} and N_{err-b} are direct input data received through the fault information terminal, the line terminals or the ID cards, and Q_{kisyu} , Q_{kotel} , Q_{naiyo} and Q_{buhin} are calculated from the direct input data above.

(C) State of operators

30 T_{m-stp} : stop time in the same spot

t_{m-out} : traveling time outside of the normal working site (time)

C_{m-out} : number of moving outside from the normal working site (number),

where T_{m-stp} , T_{m-out} and C_{m-out} are calculated from sensor input signals for detecting each operator at each working site.

[0053] The methods for reading input data for the parameters are explained below.

35 (A) As time data information of each process, each work start time of a process is input from the ID card and work end time is input from the keyboard by each operator. The start time and the end time of each process can be automatically recorded from the ID card attached to each product when it passes through the working site. The work end time can be input from the keyboard by an operator when the operator completes the process or as the last signal generated from a robot or an automated unit when the process is completed by the robot or the automated unit.

40 (B) As faulty product information, data such as types, occurring time, processes, contents, parts and otherwise regarding faulty product occurrence frequencies are recorded through the fault information terminal, the line terminals or ID card.

45 When a faulty product is found, the contents of the fault are transmitted to the line host controller. The contents include the test result information written on the ID card or a hard disk in each product.

50 (C) As operator location information, data such as accumulated time the operator spent at the working site at which the operator spent the main working hours of the day, accumulated time the operator spent outside the normal working site, and the frequency that the operator moved outside the normal working site are calculated from sensor signals, which detect the operators working at each working site. The sensors are connected to each programmable controller located at each working site. The data are stored in a memory area in the line host controller. The sensors may be touch sensors attached to a mat placed at a working site, thereby monitoring the location of the operator.

[0054] Fig. 5 is explained below. In Fig. 5, the numeral following the letter "S" indicates the step number.

55 (STEP S1) : Initialize all flags to zero (normal state) in the memory area of the line host controller.

(STEP S2) : Read all parameter data described above.

(STEP S3) : Calculate all parameters described above.

(STEP S4) : Register necessary information into a file related to a critical fault that should be input by a keyboard, which belongs to the fault information terminal, thereby verifying the occurring fault event with the registered information. If the event is determined as a critical fault, go to STEP S11, if not go to STEP S5.

5 (STEP S5): Compare each parameter data with each threshold value of the corresponding caution level, if the value of the parameter data is less or equal to the threshold value, return to STEP S2, if not, go to STEP S6.

(STEP S6): Check whether any of the flags are zero (indicates normal condition) or not, if yes, go to STEP S13, if no, go to STEP S7.

(STEP S7): Compare each parameter data with each threshold value of the corresponding hazard level, if the value of the parameter data is less or equal to the threshold value, return to STEP S2, if not, go to STEP S8.

10 (STEP S8): Set the flag for hazard to 1.

(STEP S9): Input data into a memory area of the production line based on a modified table that is obtained by calculating the production line balance considered most appropriate.

(STEP S10): Output work change order information ordering work to be changed determined from the modified table via each line terminal.

15 (STEP S11): Stop the production line, i.e., stop new supply to the line, and stop all delivery conveyors except the aging device.

(STEP S12): Output the work order for the next production. For example,

20 (a) Retire, i.e., return returned goods to a repair process, where the returned goods mean semi-assembled products that cannot continue to the following production process in the middle of the production line because of faults.

(b) Input the keyboard and note the completion of the process

(c) Command the restart procedure

25 (STEP S13): Change the data in the operator table indicating identification number, name and rating of operators. In the change, each working time for each process M1, M2 and M3 is calculated based on the ID card information or the key board operations by each operator input at every work end time and the rating for each operator is determined as follows.

30 Planned work man-hour

= standard work time \times 100/rating data stored in the operator table

Real work man-hour

= standard work time \times 100/current operator rating data

40 where the current operator rating data is calculated from each process work time obtained from the input data input via ID card or each line terminal keyboard. The current rating is calculated by solving the two formulae above.

Current operator rating data

45 = (Planned work man-hour/Real work man-hour) \times Rating data stored in the operator table

Furthermore, in STEP S13, preparation for work assignment with the modification table proceeds.

50 Namely, the process for generating a schedule file includes information pertaining to the completion of work preparation, the work start date, the code of a product type, the name of equipment, the number of products, the sequence of work and the work start time of each process, and an individual process work file includes the product name for manufacturing, the production number, the work start time and the work contents.

(STEP S14): Set caution flag to 1.

55 Fig. 6 is a table example showing a calculation process of a production line balance considered most appropriate before modification, and

Fig. 7 is a table of the same after modification.

[0055] In Fig. 6 and Fig. 7, X_1 to X_{21} indicate the man hours of each operator, A_1 to A_3 indicate the sum of man-

hours of each process, R_1 to R_3 indicate the rating of each operator, m indicates the number of processes and n indicates the number of individual work. In these drawings, $m = 3$ and $n = 21$.

[0056] In the example shown in Fig. 7, the calculating method is shown to realize the most appropriate production line balance when the operator rating for the process M_2 changes from 80 to 70.

5 [0057] Hereinafter, the mode of operations is explained. Before the explanation, various kinds of files stored in a disc in the line host controller are explained. These files include work contents, operators, time change and standard parts feeding sequence previously generated and can be maintained by the host controller terminal, files for stock parts control and maintenance tools loaded to a disc in the line host controller, a file for a work order such as manufacturing number input from the production control system, a schedule file to improve the productivity of the production line 10 generated from the production system, and the individual process file.

15 [0058] Fig. 8A and Fig. 8B show a table example for a work contents file stored in a memory area of a line host controller. Type code 10451 and 74329 correspond to product name α and β , respectively. In each product, various kinds of work is assigned, for example, work name X_1 to X_{21} are assigned to the product name α , while work names X_{22} and thereafter are assigned to the product name β . As for each work name, data such as work contents, assembling parts, preparation and cleaning hours, working man-hours, working sequence and cautions (not shown in the table) are stored in a disk in the line host controller. And as for assembling parts, the data such as parts name, parts supplied and quantity of parts are stored. As for preparation and cleaning hours, hours for preparation and cleaning data are stored, respectively.

20 [0059] In the work sequence column, numerical data 1 to 18 are stored for the product name α . The numerical data are ordered in accordance with how effectively the product name α can be assembled by processing individual work names X_1 to X_{21} in order. If there are more than two similar numerical numbers to each work name, work contents of the work name can be started for whichever work content is first. Furthermore, the time of preparation and cleaning hours and the work man-hours may be measured in minutes or seconds.

25 [0060] As a caution column, for example, for work name X_5 , "Metal fitting should be mounted to the far left side.", and as for work name X_{15} , "No gap with upper cover", important message data for assembling work are explained. The work contents file explained above is constructed by this data base or otherwise.

[0061] Fig. 9A, Fig. 9B and Fig. 9C are table examples for an operator file, a highly efficiency working time zone file and a normal production sequence file respectively stored in a memory area of a line host controller.

30 [0062] Fig. 9A indicates an operator file. In this file, identification number data, name data and rating data of each operator are stored.

[0063] Fig. 9B indicates a time zone during which an operator can work effectively.

[0064] Fig. 9C indicates the type code in the left column, and the production sequence number in the right column. If the same production sequence number exists in a different type code, any type code product can be produced first.

35 [0065] Fig. 10A is a table example for a maintenance tool file stored in a memory area of a line host controller. This table in particular shows data for current maintenance tool stock quantities for a test process. The data decreases when the tools are brought to the production line and increases when the tools are returned from the line.

[0066] Fig. 10B is a table example of a parts list file stored in a memory area of a line host controller. This table shows a parts list including maintenance tools for a product name α . From this file, the name and number of maintenance tools used for each product can be determined.

40 [0067] Fig. 10C is a table example of a production command file stored in a memory area of a line host controller. As shown, production command data such as the work start up date, the type and code, the name of products, the manufacturing quantities and the scheduled completion date are stored in the file.

[0068] Fig. 11A is a table example of a process base file stored in a memory area of a line host controller. For each process such as M_1 , M_2 and M_3 , data pertaining to the products name, the quantities of manufacturing, the work start up date and time, the tact pitch (measured in seconds or minutes) and the work contents are stored in the file. As the work contents data, work name data X_1 to X_{21} are stored.

45 [0069] Fig. 11B is a table example of a schedule file stored in a memory area of a line host controller. In this file, data of the work start up date, the type and code, the production number, the production sequence number and the work start up time for the first process M_1 are stored. As mentioned above, each file such as the work content, the operator, the time zone and the production sequence number are previously made, the parts list file and the maintenance tool file are then loaded, and after the production command data from the production control system are input, each following step and a process base work file and a schedule file can be obtained.

50 [0070] Fig. 12 is a first part of a process flow chart for generating a work order sheet arranging a production line balance that is most appropriate. In the drawings, the numeral following the letter "S" indicates the step number. Each file such as the work contents, the operators, the time zone and the standard parts feeding sequence, and each parts list file and maintenance tool file are previously loaded. And the production command signal for manufacturing the number of products is received from the production control system. The contents of these files are described in the following.

(STEP S1) : Determine whether or not all assembling parts are provided. If yes, go to STEP S3, if no, go to STEP S2. This is determined by comparing each part quantity data to compose a product that is written in a parts list file for the product that is produced in the next process with the stock quantity data of each part stored in the disc of the line host controller as parts control. Namely, the stock quantity is checked to determine whether or not there is the necessary quantity for making a product in the next process. Stock quantities are always checked whenever parts are supplied to or removed from the stock.

(STEP S2) : Determine whether or not to continue the process when there is insufficient stock. If it is determined to continue, go to STEP S3, if not, return to STEP S1. The process can be continued if the operator determines that the missing parts can be provided later.

(STEP S3) : Read the production command from the production control system.

(STEP S4) : Determine whether or not the production command file is completed. If yes, go to STEP S7, if no, go to STEP S5.

(STEP S5) : Read the type code and find the standard parts feeding sequence.

(STEP S6) : Make a schedule file in which the work start date, the type code, the name of a product, the quantity of the manufacturing product, the work sequence and the work start time of a determined work process are provided.

(STEP S7) : Sort the schedule file in the order of the feeding sequence number. STEP S3 to S6 described above are stages for determining the feeding sequential number for the production system command.

[0071] Fig. 13 is a second part of the flow chart continuing to Fig. 12.

(STEP S11) : Assume total work number is n quantities, total work man-hour is X minutes, each work man-hour is X_n minutes and the process number is m quantities. As a No. 1 method, assume

(total work man-hour/process number = X/m) = $A_{l1} = A_{l2} =$

--- A_{lm} minutes, while as a No. 2 method, assume

$A_{l1} = (\text{total work man-hour}) \times R_1/(R_1 + R_2 + \dots + R_m)$

$A_{l2} = (\text{total work man-hour}) \times R_2/(R_1 + R_2 + \dots + R_m)$

$A_{lm} = (\text{total work man-hour}) \times R_m/(R_1 + R_2 + \dots + R_m)$

Set the work man-hours for each process as A_m minutes, the imaginary process man-hours as A_F minutes, the Rating as R and changeable values as L and J . Where, the original settings of X , A_{lm} , A_m , A_F and L are 0, while the original setting of $J = 1$.

(STEP S12) : Compare J with m . If J is larger than m , go to STEP S16. If J equals m or J is less than m , go to STEP S13.

(STEP S13) : Compare A_J with A_{lm} . If A_J is larger than A_{lm} , go to STEP S15. If A_J equals A_{lm} or A_J is less than A_{lm} , go to STEP S14.

(STEP S14) : Add L plus 1 and update the data. Add A_J plus X_L and update the A_J data.

(STEP S15) : Add $J + 1$ and update the J data in the memory.

(STEP S16) : Compare the variable data L with the total work number n . If L is larger than n , go to STEP S21, if L equals n or if L is less than n , go to STEP S17.

(STEP S17) : Add L plus 1 and update the data L . Add A_F to X_F and update the A_F data in the memory.

[0072] Fig. 14 is the last part of the flow chart continuing to Fig. 13. Divide A_F , an element of imaginary process man-hours into X_ℓ , $X_{\ell+1}$, ..., X_n . For minimizing production line tact, the line balance loss, that is, redundant time from the time difference between the working time of each process will be minimized in the following method.

[0073] Calculate the element number n' of imaginary process man-hours A_F from $n - 1 + 1$. And calculate the total working man-hours Y after multiplying the rating using the following formula (1).

$$Y = A_1 \times 100/R_1 + A_2 \times 100/R_2 + \dots + A_m \times 100/R_m + X_\ell + X_{\ell+1} + \dots + X_n \quad (1)$$

5 average value $y = Y/m$ (2)

Calculate the formula (2) and calculate the difference between the average and the man-hours of each process from the formula (3).

10 $\Delta A_1 = y - (A_1 \times 100/R_1 + X_\ell \times Z_{11} + X_{\ell+1} \times Z_{12} + \dots + X_n \times Z_{1n})$

$\Delta A_2 = y - (A_2 \times 100/R_2 + X_\ell \times Z_{21} + X_{\ell+1} \times Z_{22} + \dots + X_n \times Z_{2n})$

15 \dots

$\Delta A_m = y - (A_m \times 100/R_m + X_\ell \times Z_{m1} + X_{\ell+1} \times Z_{m2} + \dots + X_n \times Z_{mn})$ (3)

[0074] Then execute the following steps.

20 (STEP S21): Set the average value y previously calculated as the variable number O_p to determine the line balance.

(STEP S22): Set all 0 from matrix Z_{11} to Z_{mn} , where Z_{11} to Z_{mn} are variable data of 1 or 0.

(STEP S23): In Loop 1 from 1 to m in the variable number $Z_{\text{LOOP } 1, 1}$, in Loop 2 from 1 to n in the variable number $Z_{\text{LOOP } 2, 2}$, \dots , and in Loop n' from 1 to m in the variable number $Z_{\text{LOOP } n', n'}$, execute STEP S24, STEP S25 and STEP S26 and return to STEP S22.

(STEP S24): Calculate from ΔA_1 to ΔA_m .

(STEP S25) : Add the minimum value of the absolute value of ΔA_1 to ΔA_m with the maximum value of the absolute value of ΔA_1 to ΔA_m , and set the sum as a loss data.

(STEP S26) : Compare the Loss value with O_p value, if the Loss value equals the O_p value or is less than the O_p value, go to step S27. If the Loss value is larger than the O_p value, go back to STEP S22.

(STEP S27) : Set the Loss value as a variable number O_p .

(STEP S28) : Memorize variable number Z_{op1} from the LOOP_1 from 1 to m . Memorize variable number Z_{op2} from the LOOP_2 from 1 to m . Memorize variable number $Z_{opn'}$ from the $\text{LOOP}_{n'}$ from 1 to m .

From this, it is determined which of Z_{11} to Z_{mn} is set to 1 for each process, in other words, it is determined which work is processed in which process, namely, each matrix data 1 or 0 for Z_{11} to Z_{mn} is determined.

(STEP S29) : Generate the process based work file that indicates when and what time the work process starts, what product is going to be manufactured and which work should be executed.

[0075] Fig. 15 is a table example showing a first calculation process of a production line balance considered most appropriate. This example shows how to calculate and minimize the line balance loss under the total number of operations is 21($n=21$), the number of processes such as M1, M2 and M3 is 3 ($m=3$), and each operator rating is $R_1=110$, $R_2=80$, and $R_3=95$, respectively.

[0076] Each work man-hours X_1, X_2, \dots, X_{21} is as shown in Fig. 15, the sum of X_1 to X_6 is A_1 equals 62, if X_7 is added to A_1 , the sum becomes 80, which is larger than $A_{1m} = 213/3 = 71$ (total work man-hour/process number). So that processes after X_7 are determined as the next operator's work processes.

[0077] Then the sum of X_7 to X_9 , which is A_2 , is 49, and A_2 plus X_{10} equals 72, which is larger than $A_{2m} = 71$. So that processes after X_{10} are determined as the next operator's work processes.

[0078] Then, the sum of X_{10} to X_{14} , which is A_3 , is 63, and A_3 plus X_{15} becomes 72, which is larger than $A_{3m} = 71$. So that processes after X_{15} to X_{21} are shared by 3 operators. In each work process, the rating multiplied values become 57, 62 and 67 respectively as shown in Fig. 15. In this way, assigning work to each process so as to minimize the line balance loss can be determined as shown in Fig. 15. It is understood that each work process becomes 75 and the line balance loss becomes 0.

[0079] Fig. 16 is a table example showing a second calculation process of a production line balance considered most appropriate. This example shows how to calculate and minimize the line balance loss under the condition that the total number of works is 21 ($n=21$), the number of processes, such as M1, M2 and M3 is 3 ($m=3$), and each operator rating is $R_1 = 110$, $R_2 = 80$ and $R_3 = 95$, respectively. Each work man hours X_1, X_2, \dots, X_{21} is as shown in Fig. 16, the total working man-hours X is 213, which is the sum of the man-hours of each process.

[0080] In this 2nd method, each operator shared man-hours A_{im} is calculated by the following equation. $A_{im} = X \times R_i / (R_1 + R_2 + R_3)$ (m=1 to 3), where X is the sum of the man-hours of each process, R_i is a rating of each process.

5 $A_{i1} = 213 \times 110 / (110 + 80 + 95) = 82.2$

10 $A_{i2} = 213 \times 80 / (110 + 80 + 95) = 59.8$

$A_{i3} = 213 \times 95 / (110 + 80 + 95) = 71$

[0081] Now, the sum A_1 of X_1 to X_7 is 80, and by multiplying A_1 by the rating, the value $80 \times 100 / 110 = 72.7$ is obtained. Processes after X_8 are determined as the next operator's work processes. Then the sum of X_8 to X_{10} , which is A_2 , is 52, and by multiplying A_2 by the rating, the value $54 \times 100 / 80 = 67.5$ is obtained. Processes after X_{11} are determined as the next operators' work processes.

[0082] The sum of X_{11} to X_{19} , which is A_3 , is 70, and by multiplying A_3 by the rating, the value $70 \times 100 / 95 = 97.3$ is obtained. Last of all, the rest of the man-hours are shared by 3 operators. In this case, each work $X_{20} = 3$ and $X_{21} = 6$ is shared by M1 and M2 respectively, then calculate $A_1' = 72.7 + 3 = 75.7$, $A_2' = 67.5 + 6 = 73.5$ and $A_3' = 73.7$.

20 Accordingly, it is understood that sharing work to minimize line balance is as shown in Fig. 16.

[0083] Fig. 17A and Fig. 17B show each half part of a collection of display examples of work order sheets. These displays show work order sheets at an assembling site No. 1 at every tact interval, such as t_0, t_1, \dots, t_5 . In the drawings, although they are not shown, the displays at the assembling site No. 2 show the same displays as No. 1 after delaying one tact time interval; the displays at the assembling site No. 3 show the same displays as No. 2 after delaying one tact time interval.

[0084] The drawings indicate that products α and products β are to be assembled individually. The work contents for assembling the products α and β , and cautions are also displayed. And, if there is no work content, messages for work preparation and work end reports are shown on the screen.

[0085] Fig. 18A is a display example when faulty unit data of each product is input and Fig. 18B is a display example when the product error codes are input.

[0086] In Fig. 18A, operators input

- 00 when the test process is a basic process,
- 01 when the test process is an aging process,
- 02 when the test process is the last process.

In the same way, corresponding codes pertaining to the temperature condition, voltage condition and impulse condition are input.

[0087] As shown in Fig. 18B, operators input error codes for each fault phenomenon through the fault information terminal by viewing the CRT screen connected with the fault information terminal.

[0088] Fig. 19A is a display example of a unit list for a product before replacing faulty units, Fig. 19B is a display example of a unit list for a product after replacing faulty units.

[0089] Fig. 19A displays the case when a 3.5 inch size floppy disk is determined a faulty disc at No. 6 unit product. In this case, when input 06 by operating the keyboard at the terminal, the data No. 6 is deleted from the disc of the line host controller.

[0090] Fig. 19B shows the screen after rewriting the lot number, the parts number of the semi-assembled product unit after repairing the semi-assembling unit by replacing the new unit for the fault unit No. 6.

[0091] As heretofore explained a versatile production system and methods for operating the same that can monitor the running condition of the system and diagnose abnormal conditions immediately are provided, thereby generating work order sheets for each operator reflecting the diagnostic results. Furthermore, the present invention provides a versatile production system and methods for operating the same that provide work order sheets so as to increase productivity and minimize tact balance loss for the production line corresponding to the work change command generated from the production control system; namely, the system automatically and swiftly generates the schedule file and the process base work file.

Claims

1. A versatile production system comprising:

5 at least one assembling site (1) for assembling parts sequentially delivered and for making various kinds of products on a single production line;

at least one testing site (2) for testing and inspecting the performance or quality of assembled products;

10 a plurality of line terminals (3) installed at any of said assembling sites (1) or said testing sites (2);

a communication-memory unit (4) attached to and flowing with either a said product or a pallet carrying a said product, said communication-memory unit (4) exchanging manufacturing data with said line terminals (3) and memorizing data when its associated pallet or product is conveyed to said production line;

15 a line host controller (5) which reads said memorized data from said communication-memory unit (4) via said line terminals (3) and uses the read data to output work order sheets for operators working at said assembling sites (1) and said testing sites (2) via said line terminals (3);

20 a line host control terminal (6) that directly inputs and outputs data for master file maintenance to/from said line host controller, said data for master file maintenance including work order control data, progress control data, schedule arrangement data and machine history related data, and

a faulty product information terminal (7) which inputs fault code data to the line host controller (5) showing the presence of faulty products which should be replaced, the said faulty product information terminal (7) being used to delete said fault code data after correction of a fault by replacing said faulty products.

2. A versatile production system according to claim 1 wherein said line host controller (5) monitors parameters such as time control, quality conditions and states of operators for running conditions of said versatile production line, compares said parameter data with a caution level threshold value and displays a caution notice when said parameter data is larger than said caution threshold value through said line terminals (3) or said line host control terminal (6).

3. A versatile production system according to claim 1 wherein said line host controller (5) monitors parameters such as time control, quality conditions and states of operators for running conditions of said production line, compares said parameter data with a hazard level threshold value and displays a hazard notice when said parameter data is larger than said hazard level threshold value through said line terminal (3) or said line host control terminal (6), and outputs work orders for rearranging said production line.

4. A versatile production system according to claim 1 wherein said line host controller (5) monitors parameters such as time control, quality conditions and states of operators for running conditions of said production line, compares said parameter data with a critical fault level threshold value and stops said production line, displays and outputs work orders for operators, thereby providing next work operations through said line terminals (3) or said line host control terminal (6) when said parameter data is larger than said critical threshold value.

5. A versatile production system according to claim 1 wherein parameter related time control is calculated after communication with said line host controller (5) via said line terminals (3) concerning said memorized data in said communication-memory unit (4).

6. A versatile production system according to claim 1 wherein said parameter related quality conditions are calculated from data communicated with said line host controller (5) via said line terminals (3) or said fault product information terminal (7).

7. A versatile production system according to claim 1 wherein said parameters related to states of operators are calculated from sensor signals, which are installed in said work places for operators and electrically connected to a programmable controller and said sensor signals are transmitted to said line host controller (5) via said line terminals (3).

8. A method for operating a versatile production system, said versatile production system having at least one assembling site (1) for assembling parts sequentially delivered and for making various kinds of products on a single production line; at least one testing site (2) for testing and inspecting the performance or quality of assembled products and a plurality of line terminals (3) installed at any of said assembling sites (1) or said testing sites (2); wherein said method comprises

exchanging manufacturing data between a communication-memory unit (4), attached to and flowing with either said product or a pallet carrying said product, and said line terminals (3), and memorizing data when the associated pallet or product is conveyed to said production line;

5 reading said memorized data from said communication-memory unit (4) via said line terminals (3) by a line host controller (5) and using the read data to output work order sheets for operators working at said assembling sites (1) and said testing sites (2) via said line terminals (3);

10 directly inputting and outputting data for master file maintenance to/from said line host controller (5) by a line host control terminal (6), said data for master file maintenance including work order control data, progress control data, schedule arrangement data and machine history related data;

15 inputting fault code data to the line host controller (4) by a faulty product information terminal (7), said fault code data showing the presence of faulty products which should be replaced, and using the said faulty product information terminal (7) to delete said fault code data after correction of a fault by replacing said faulty products;

wherein said method further comprises

20 a first step that monitors parameter data such as time control, quality conditions and state of operators for running conditions of said production line;

a second step that compares said parameter data with a caution level threshold value;

25 and a third step that displays a caution notice, when said parameter data is larger than said caution level threshold value, through said line terminals (3) or said host control terminal (6).

9. A method for operating a versatile production system according to claim 8, wherein said method comprises:

30 a step that displays a hazard notice when said parameter data is larger than said hazard level threshold value through said line terminal (3) or said line host control terminal (6); and

a step that outputs work orders for rearranging said production line.

35 10. A method for operating a versatile production system claimed in claim 9, wherein said production line is rearranged by means of changing the work man-hours for each operator and the number of operators, and the work place changes depending on the operators' rating.

11. A method for operating a versatile production system according to claim 8 or 9, wherein said method comprises

40 a further step that compares said parameter data with a critical fault level threshold value;

a step that stops said production line;

45 and a further step displays and outputs work orders for operators, thereby providing next work operations through said line terminals (3) or said line host control terminal (6) when said parameter data is larger than said critical threshold value.

Patentansprüche

50

1. Vielseitiges Produktionssystem, umfassend:

zumindest einen Montageplatz (1) zum Zusammenbauen von Teilen, welche nacheinander angeliefert werden, und zum Herstellen verschiedener Arten von Produkten auf einer einzigen Fertigungsstraße;

55

zumindest einen Testplatz (2) zum Testen und Überprüfen der Leistung oder Qualität von zusammengebauten Produkten;

eine Mehrzahl von Fertigungsstraßenterminals (3), welche an einem oder mehreren Montageplätzen (1) oder Testplätzen (2) installiert sind;

5 eine Kommunikationsspeichereinheit (4), welche entweder an einem der Produkte oder einer Palette, welche eines der Produkte trägt, befestigt ist und damit mitbewegt wird, wobei die Kommunikationsspeichereinheit (4) Fertigungsdaten mit den Fertigungsstraßenterminals (3) austauscht und Daten speichert, wenn die ihr zugeordnete Palette oder das ihr zugeordnete Produkt zur Fertigungsstraße befördert wird;

10 eine Fertigungsstraßenkontrolleinheit (5), welcher die gespeicherten Daten aus der Kommunikationsspeichereinheit (4) über die Fertigungsstraßenterminals (3) ausliest und die gelesenen Daten verwendet, um Arbeitsauftragsblätter für Bedienpersonen, welche an den Montageplätzen (1) und den Testplätzen (2) arbeiten, über die Fertigungsstraßenterminals (3) auszugeben;

15 ein Fertigungsstraßenkontrolleinheitsterminal (6), welches Daten zur Stammdatenpflege direkt zur Fertigungsstraßenkontrolleinheit eingibt und von diesem ausgibt, wobei die Daten zur Stammdatenpflege Arbeitsauftragssteuerdaten, Fortschrittssteuerdaten, Terminierungsdaten und historische Maschinendaten umfassen, und

20 ein Produktfehlerdatenterminal (7), welches Fehlercodedaten, welche das Vorliegen fehlerhafter Produkte anzeigen, die ausgetauscht werden sollten, zur Fertigungsstraßenkontrolleinheit (5) eingibt, wobei das Produktfehlerdatenterminal (7) verwendet wird, um die Fehlercodedaten nach Behebung eines Fehlers durch Austausch der fehlerhaften Produkte zu löschen.

25 2. Vielseitiges Produktionssystem nach Anspruch 1, wobei die Fertigungsstraßenkontrolleinheit (5) Parameter wie Zeitsteuerung, Qualitätsbedingungen und Status der Bedienpersonen für Betriebsbedingungen der vielseitigen Fertigungsstraße überwacht, die Parameterdaten mit einem Warnpegelschwellwert vergleicht und, wenn die Parameterdaten größer als der Warnschwellwert sind, eine Warnmeldung durch die Fertigungsstraßenterminals (3) oder das Fertigungsstraßenkontrolleinheitsterminal (6) anzeigt.

30 3. Vielseitiges Produktionssystem nach Anspruch 1, wobei die Fertigungsstraßenkontrolleinheit (5) Parameter wie Zeitsteuerung, Qualitätsbedingungen und Status der Bedienpersonen für Betriebsbedingungen der Fertigungsstraße überwacht, die Parameterdaten mit einem Gefahrenpegelschwellwert vergleicht und, wenn die Parameterdaten größer als der Gefahrenschwellwert sind, eine Gefahrenmeldung durch die Fertigungsstraßenterminals (3) oder das Fertigungsstraßenkontrolleinheitsterminal (6) anzeigt, und Arbeitsaufträge zum Umorganisieren der Fertigungsstraße ausgibt.

35 4. Vielseitiges Produktionssystem nach Anspruch 1, wobei die Fertigungsstraßenkontrolleinheit (5) Parameter wie Zeitsteuerung, Qualitätsbedingungen und Status der Bedienpersonen für Betriebsbedingungen der Fertigungsstraße überwacht, die Parameterdaten mit einem kritischen Fehlerpegelschwellwert vergleicht und die Fertigungsstraße anhält, Arbeitsaufträge für Bedienpersonen anzeigt und ausgibt und dadurch über die Fertigungsstraßenterminals (3) oder das Fertigungsstraßenkontrolleinheitsterminal (6) nächste Arbeitsgänge vorsieht, wenn die Parameterdaten größer als der kritische Schwellwert sind.

40 5. Vielseitiges Produktionssystem nach Anspruch 1, wobei die parameterbezogene Zeitsteuerung nach Kommunikation mit der Fertigungsstraßenkontrolleinheit (5) über die Fertigungsstraßenterminals (3) mit Hinblick auf die gespeicherten Daten in der Kommunikationsspeichereinheit (4) ermittelt wird.

45 6. Vielseitiges Produktionssystem nach Anspruch 1, wobei die parameterbezogenen Qualitätsbedingungen aus Daten ermittelt werden, welche mit der Fertigungsstraßenkontrolleinheit (5) über die Fertigungsstraßenterminals (3) oder das Produktfehlerdatenterminal (7) übertragen werden.

50 7. Vielseitiges Produktionssystem nach Anspruch 1, wobei die Parameter, welche Status der Bedienpersonen betreffen, aus Sensorsignalen ermittelt werden, welche an den Arbeitsplätzen für Bedienpersonen installiert und mit einer programmierbaren Steuerung elektrisch verbunden sind, und wobei die Sensorsignale über die Fertigungsstraßenterminals (3) zur Fertigungsstraßenkontrolleinheit (5) übertragen werden.

55 8. Verfahren zum Betreiben eines vielseitigen Produktionssystems, wobei das vielseitige Produktionssystem zumindest einen Montageplatz (1) zum Zusammenbauen von Teilen, welche nacheinander angeliefert werden, und zum

Herstellen verschiedener Arten von Produkten auf einer einzigen Fertigungsstraße; zumindest einen Testplatz (2) zum Testen und Überprüfen der Leistung oder Qualität von zusammengebauten Produkten und eine Mehrzahl von Fertigungsstraßeterminals (3), welche an einem oder mehreren Montageplätzen (1) oder Testplätzen (2) installiert sind, aufweist;

5 wobei das Verfahren umfaßt:

Austauschen von Fertigungsdaten zwischen einer Kommunikationsspeichereinheit (4), welche entweder an dem Produkt oder an einer Palette, welche das Produkt trägt, befestigt ist und damit mitbewegt wird, und den Fertigungsstraßeterminals (3) und Speichern von Daten, wenn die zugeordnete Palette oder das zugeordnete Produkt zur Fertigungsstraße befördert wird;

10 Auslesen der gespeicherten Daten aus der Kommunikationsspeichereinheit (4) über die Fertigungsstraßeterminals (3) durch eine Fertigungsstraßekontrolleinheit (5) und Verwenden der gelesenen Daten, um Arbeitsauftragsblätter für Bedienpersonen, welche an den Montageplätzen (1) und den Testplätzen (2) arbeiten, über die Fertigungsstraßeterminals (3) auszugeben;

15 direktes Eingeben und Ausgeben von Daten zur Stammdateneipflege zu bzw. von der Fertigungsstraßekontrolleinheit (5) durch ein Fertigungsstraßekontrolleinheitsterminal (6), wobei die Daten zur Stammdateneipflege Arbeitsauftragssteuerdaten, Fortschrittssteuerdaten, Terminierungsdaten und historische Maschinendaten umfassen;

20 Eingeben von Fehlercodedaten zur Fertigungsstraßekontrolleinheit (4) durch ein Produktfehlerdatenterminal (7), wobei die Fehlercodedaten das Vorliegen fehlerhafter Produkte anzeigen, die ausgetauscht werden sollten, und Verwenden des Produktfehlerdatenterminals (7), um die Fehlercodedaten nach Behebung eines Fehlers durch Austausch der fehlerhaften Produkte zu löschen;

25 wobei das Verfahren des weiteren umfaßt:

30 einen ersten Schritt, welcher Parameterdaten wie Zeitsteuerung, Qualitätsbedingungen und Zustand von Bedienpersonen für Betriebsbedingungen der Fertigungsstraße überwacht;

35 einen zweiten Schritt, welcher die Parameterdaten mit einem Wampegelschwellwert vergleicht;

40 und einen dritten Schritt, welcher, wenn die Parameterdaten größer als der Warnpegelschwellwert sind, eine Warnmeldung durch die Fertigungsstraßeterminals (3) oder das Leitregelterminal (6) anzeigt.

9. Verfahren zum Betreiben eines vielseitigen Produktionssystems nach Anspruch 8, wobei das Verfahren umfaßt:

45 einen Schritt, welcher, wenn die Parameterdaten größer als der Gefahrenpegelschwellwert sind, eine Gefahrenmeldung durch das Fertigungsstraßeterminal (3) oder das Leitregelterminal (6) anzeigt; und

50 einen Schritt, welcher Arbeitsaufträge zum Umorganisieren der Fertigungsstraße ausgibt.

55 10. Verfahren zum Betreiben eines vielseitigen Produktionssystems nach Anspruch 9, wobei die Fertigungsstraße durch Ändern der Arbeitsmannstunden für jede Bedienperson und der Anzahl von Bedienpersonen umorganisiert wird und sich der Arbeitsplatz je nach Bewertung der Bedienpersonen ändert.

11. Verfahren zum Betreiben eines vielseitigen Produktionssystems nach Anspruch 8 oder 9, wobei das Verfahren umfaßt:

50 einen weiteren Schritt, welcher die Parameterdaten mit einem kritischen Fehlerpegelschwellwert vergleicht;

55 einen Schritt, welcher die Fertigungsstraße anhält;

60 und einen weiteren Schritt, welcher Arbeitsaufträge für Bedienpersonen anzeigt und ausgibt, wodurch nächste Arbeitsgänge über Fertigungsstraßeterminals (3) oder das Fertigungsstraßekontrolleinheitsterminal (6) vorgesehen werden, wenn die Parameterdaten größer als der kritische Schwellwert sind.

Revendications

1. Système de production polyvalent comprenant :
 - 5 au moins un site d'assemblage (1) destiné à l'assemblage de pièces amenées de façon séquentielle et à la fabrication de produits de différents types sur une ligne de production unique ;
 - 10 au moins un site d'essai (2) destiné à l'épreuve et l'inspection des performances ou de la qualité des produits assemblés ;
 - 15 une pluralité de terminaux de ligne (3) installés sur chaque desdits sites d'assemblage (1) ou desdits sites de test (2) ;
 - 20 une unité mémoire de communication (4) attachée à un dit produit ou une palette portant un dit produit et avec lesquels elle circule, ladite unité mémoire de communication (4) échangeant des données de fabrication avec lesdits terminaux de ligne (3) et mémorisant des données lorsque la palette ou le produit associés sont convoyés vers ladite ligne de production ;
 - 25 un contrôleur de ligne principal (5) qui lit lesdites données mémorisées de ladite unité mémoire de communication (4) via lesdits terminaux de ligne (3) et utilise les données lues pour produire via lesdits terminaux de ligne (3) des bons de travail destiné aux opérateurs travaillant sur lesdits sites d'assemblage (1) et d'essai (2) ;
 - 30 un terminal principal de contrôle de ligne (6) qui entre directement les données de maintenance de fichier permanent dans le contrôleur de ligne principal et les en sort directement, lesdites données de maintenance de fichier permanent incluant des données relatives à la gestion des bons de travail, à la gestion des progrès effectués, à la détermination des délais et à l'histoire de la machine, et
2. Système de production polyvalent selon la revendication 1 dans lequel ledit contrôleur de ligne principal (5) gère des paramètres tels que la commande de temps, les conditions de qualité et les statuts des opérateurs, relatifs aux conditions de fonctionnement de ladite ligne de production polyvalente, compare lesdites données paramétriques avec une valeur seuil d'avertissement et affiche un message d'avertissement par le biais desdits terminaux de ligne (3) ou ledit terminal principal de contrôle de ligne (6) lorsque ladite valeur paramétrique est supérieure à ladite valeur seuil d'avertissement.
3. Système de production polyvalent selon la revendication 1 dans lequel ledit contrôleur de ligne principal (5) gère des paramètres tels que la commande de temps, les conditions de qualité et les statuts des opérateurs, relatifs aux conditions de fonctionnement de ladite ligne de production polyvalente, compare lesdites données paramétriques avec une valeur seuil de danger et affiche un message de danger par le biais desdits terminaux de ligne (3) ou ledit terminal principal de contrôle de ligne (6) lorsque ladite valeur paramétrique est supérieure à ladite valeur seuil de danger, et produit des bons de travail pour réorganiser ladite ligne de production.
4. Système de production polyvalent selon la revendication 1 dans lequel ledit contrôleur de ligne principal (5) gère des paramètres tels que la commande de temps, les conditions de qualité et les statuts des opérateurs, relatifs aux conditions de fonctionnement de ladite ligne de production polyvalente, compare lesdites données paramétriques avec une valeur seuil d'erreur critique et arrête ladite ligne de production, affiche et produit des bons de travail pour des opérateurs, indiquant ainsi les prochaines opérations de travail par le biais desdits terminaux de ligne (3) ou ledit terminal principal de contrôle de ligne (6) lorsque ladite valeur paramétrique est supérieure à ladite valeur seuil critique.
5. Système de production polyvalent selon la revendication 1 dans lequel ledit contrôle de temps associé au paramètre est calculé après communication avec ledit contrôleur de ligne principal (5) via lesdits terminaux de ligne (3), cette communication concernant lesdites données mémorisées dans ladite unité mémoire de communication (4).

6. Système de production polyvalent selon la revendication 1 dans lequel lesdites conditions de qualité associées au paramètre sont calculées à partir de données communiquées avec ledit contrôleur de ligne principal (5) via lesdits terminaux de ligne (3) ou ledit terminal d'information sur les produits défectueux (7).

5 7. Système de production polyvalent selon la revendication 1 dans lequel lesdits paramètres associés aux statuts des opérateurs sont calculés à partir de signaux délivrés par des capteurs qui sont installés sur les postes de travail desdits opérateurs et connectés électriquement à un contrôleur programmable, et où lesdits signaux délivrés par des capteurs sont transmis audit contrôleur de ligne principal (5) via lesdits terminaux de ligne (3).

10 8. Procédé pour l'exploitation d'un système de production polyvalent qui présente au moins un site d'assemblage (1) destiné à l'assemblage de pièces amenées de façon séquentielle et à la fabrication de produits de différents types sur une ligne de production unique, au moins un site d'essai (2) destiné à l'épreuve et l'inspection des performances ou de la qualité des produits assemblés, une pluralité de terminaux de ligne (3) installés sur chaque desdits sites d'assemblage (1) ou desdits sites de test (2) :

15 ledit procédé comprenant

l'échange de données de fabrication entre une unité mémoire de communication (4) attachée à un dit produit ou une palette portant un dit produit et avec lesquels elle circule, et lesdits terminaux de ligne (3) et la mémorisation des données lorsque la palette ou le produit associés sont convoyés vers ladite ligne de production ;

20

la lecture par un contrôleur de ligne principal (5) desdites données mémorisées de ladite unité mémoire de communication (4) via lesdits terminaux de ligne (3) et l'utilisation des données lues pour produire via lesdits terminaux de ligne (3) des bons de travail destiné aux opérateurs travaillant sur lesdits sites d'assemblage (1) et d'essai (2) ;

25

l'entrée directe de données de maintenance de fichier permanent dans un terminal principal de contrôle de ligne (6) ainsi que leur sortie directe au moyen d'un contrôleur de ligne principal (5), lesdites données de maintenance de fichier permanent incluant des données relatives à la gestion des bons de travail, à la gestion des progrès effectués, à la détermination des délais et à l'histoire de la machine ;

30

l'entrée au moyen d'un terminal d'information sur les produits défectueux (7) dans le contrôleur de ligne principal (5) de données de code d'erreur, ces dernières indiquant la présence de produits défectueux à remplacer, ledit terminal d'information sur les produits défectueux (7) étant employé pour effacer les données de code d'erreur une fois la correction effectuée par remplacement desdits produits défectueux ;

35

ledit procédé comprenant par ailleurs

40

une première étape consistant à gérer des données paramétriques telles que la commande de temps, les conditions de qualité et le statut des opérateurs, relatives aux conditions de fonctionnement de ladite ligne de production polyvalente ;

45

une seconde étape consistant à comparer lesdites données paramétriques avec une valeur seuil d'avertissement ;

et une troisième étape consistant à afficher un message d'avertissement par le biais desdits terminaux de ligne (3) ou ledit terminal principal de contrôle de ligne (6) lorsque ladite valeur paramétrique est supérieure à ladite valeur seuil d'avertissement.

9. Procédé pour l'exploitation d'un système de production polyvalent selon la revendication 8, ledit procédé comprenant :

50

une étape consistant à afficher un message de danger par le biais dudit terminal de ligne (3) ou dudit terminal principal de contrôle de ligne (6) lorsque ladite valeur paramétrique est supérieure à ladite valeur seuil de danger, et

55

une étape consistant à produire des bons de travail pour réorganiser ladite ligne de production.

10. Procédé pour l'exploitation d'un système de production polyvalent selon la revendication 9, ladite ligne de produc-

tion étant réorganisée par changement des heures de travail par personne pour chaque opérateur ainsi que du nombre des opérateurs, et le poste de travail changeant en fonction de la qualification de ces derniers.

11. Procédé pour l'exploitation d'un système de production polyvalent selon la revendication 8 ou 9, ledit procédé
5 comprenant

une étape supplémentaire consistant à comparer lesdites données paramétriques avec une valeur seuil d'erreur critique ;

10 une étape consistant à arrêter ladite ligne de production

et une autre étape consistant à afficher et produire des bons de travail pour des opérateurs, indiquant ainsi les prochaines opérations de travail par le biais desdits terminaux de ligne (3) ou ledit terminal principal de contrôle de ligne (6) lorsque ladite valeur paramétrique est supérieure à ladite valeur seuil critique.

15

20

25

30

35

40

45

50

55

Fig.1

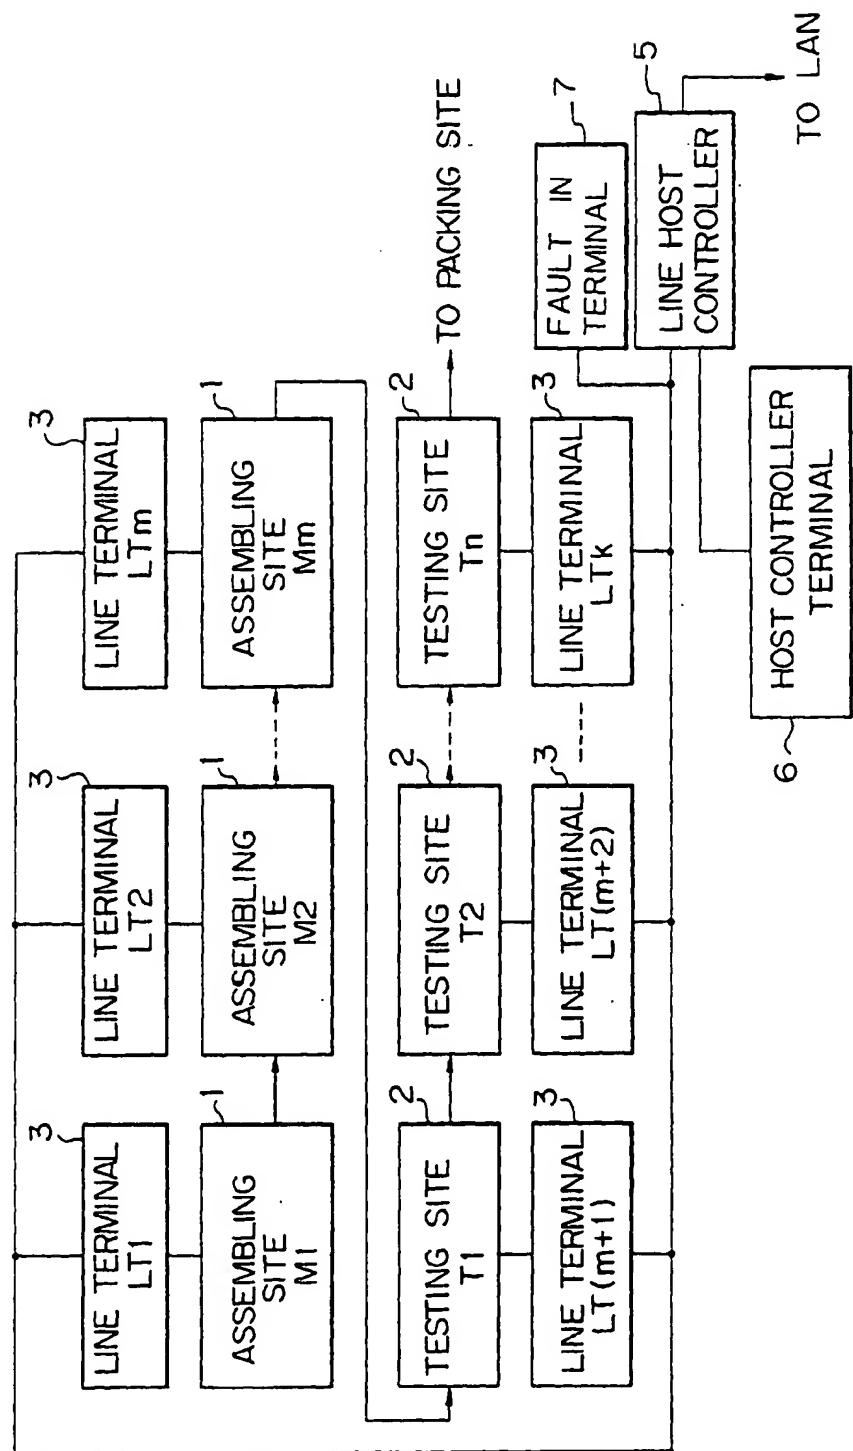


Fig. 2

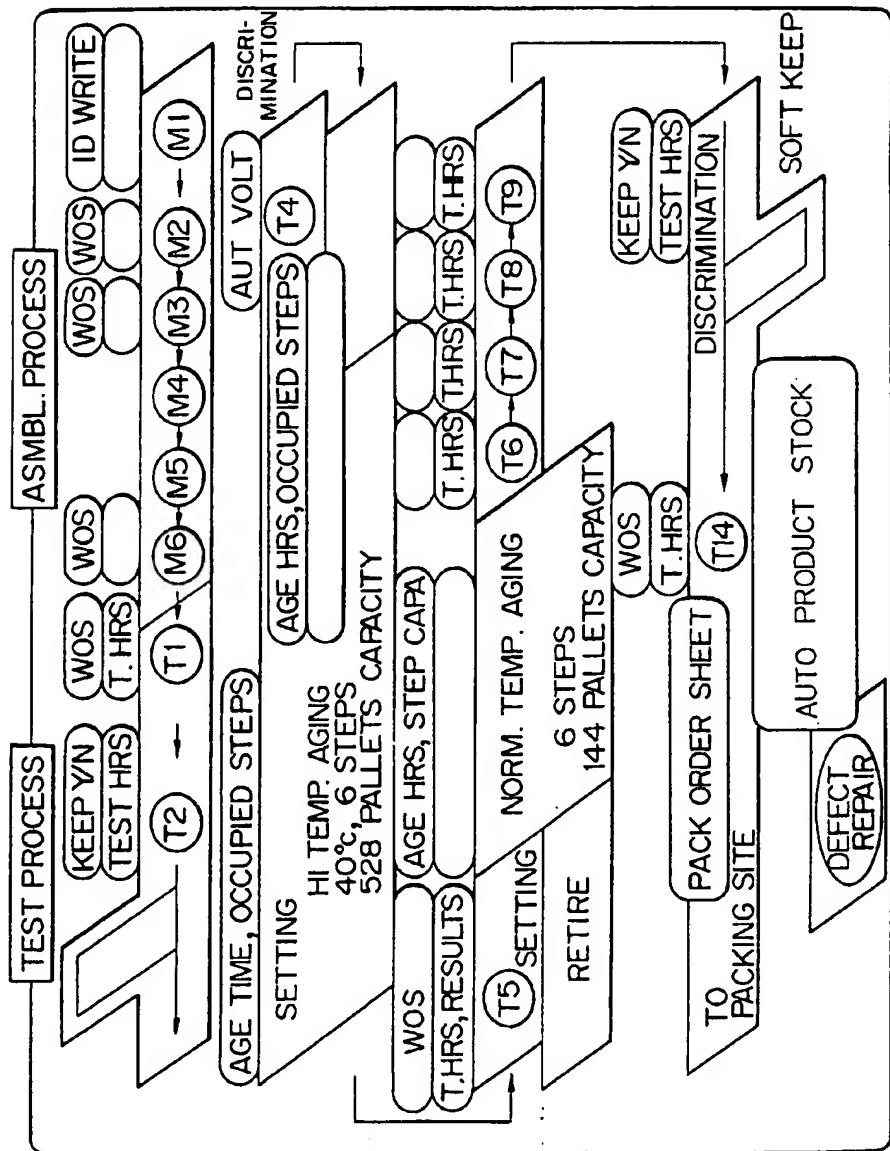


Fig.3

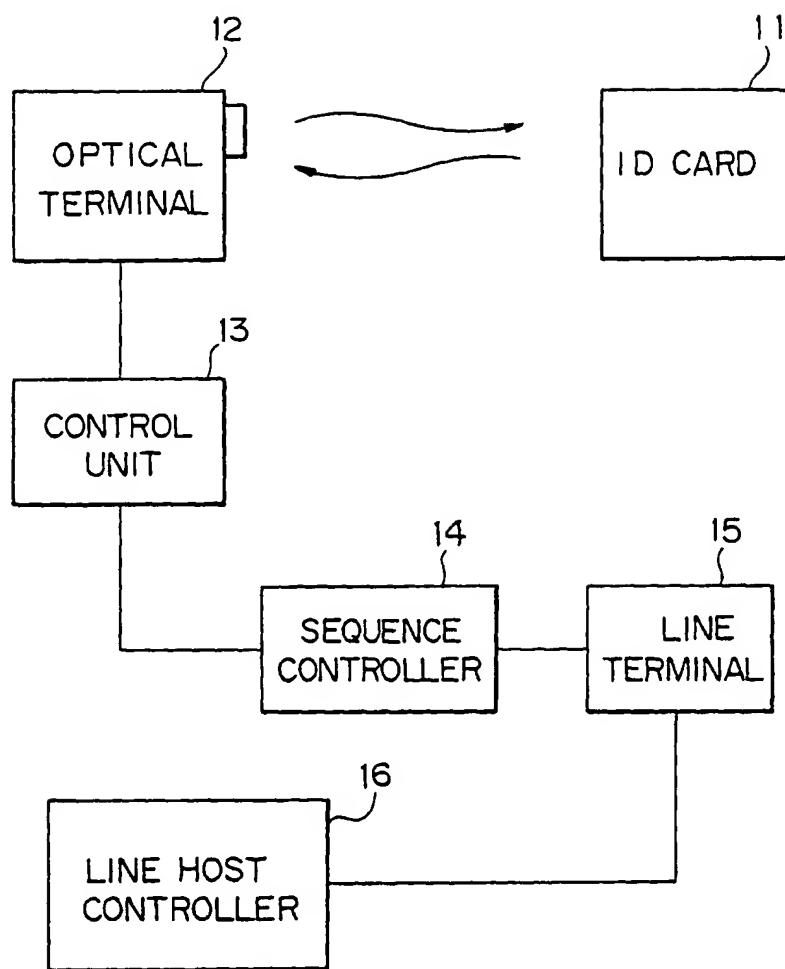


Fig. 4

FORMAT OF ID CARD

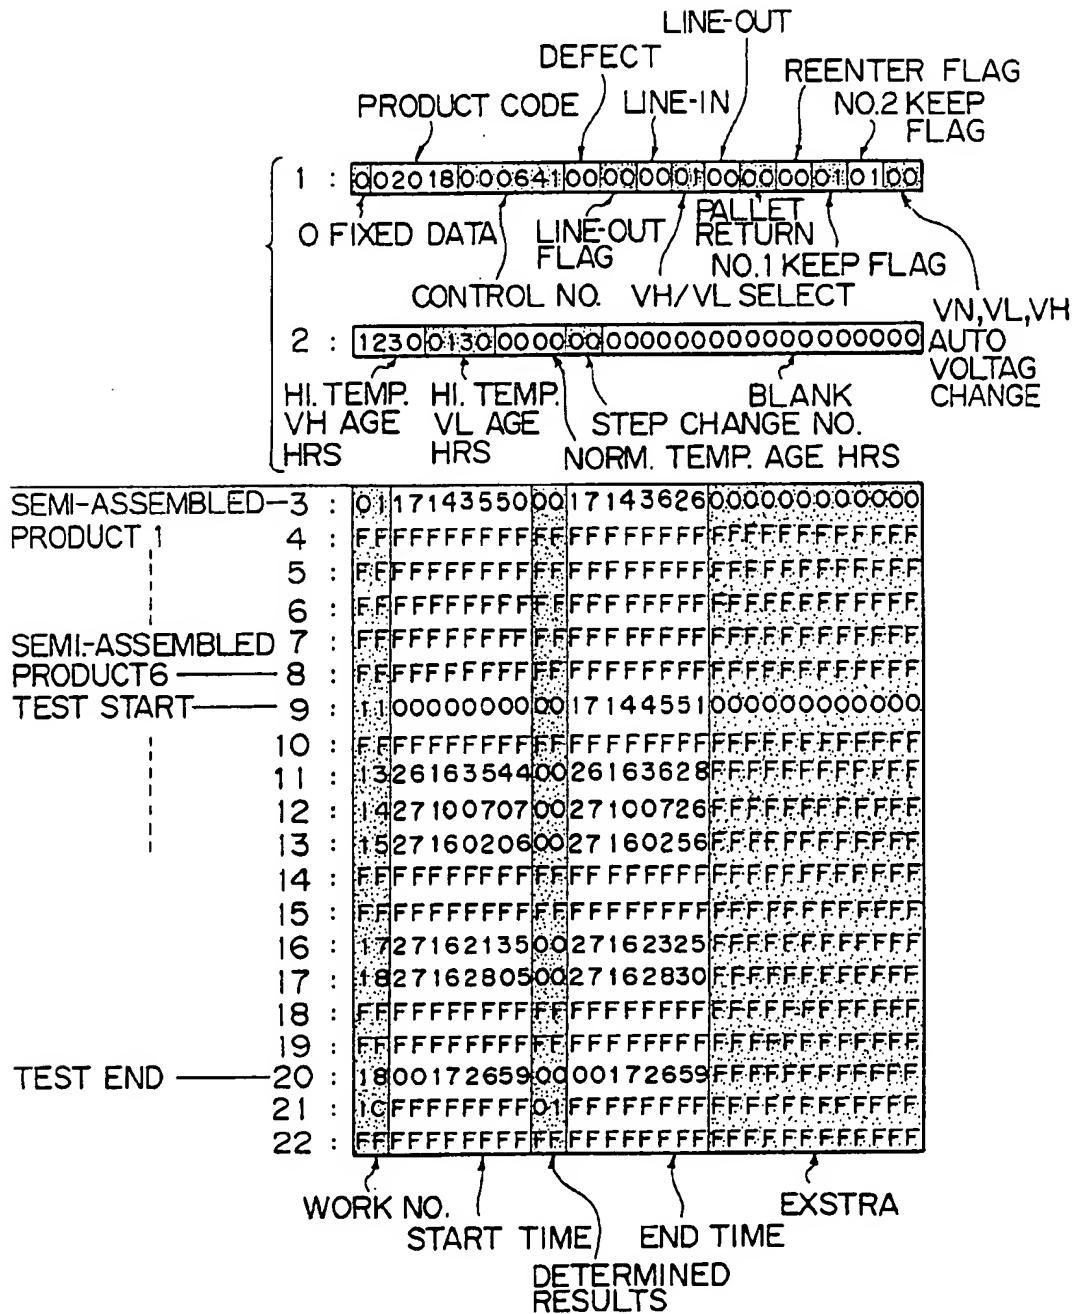


Fig. 5

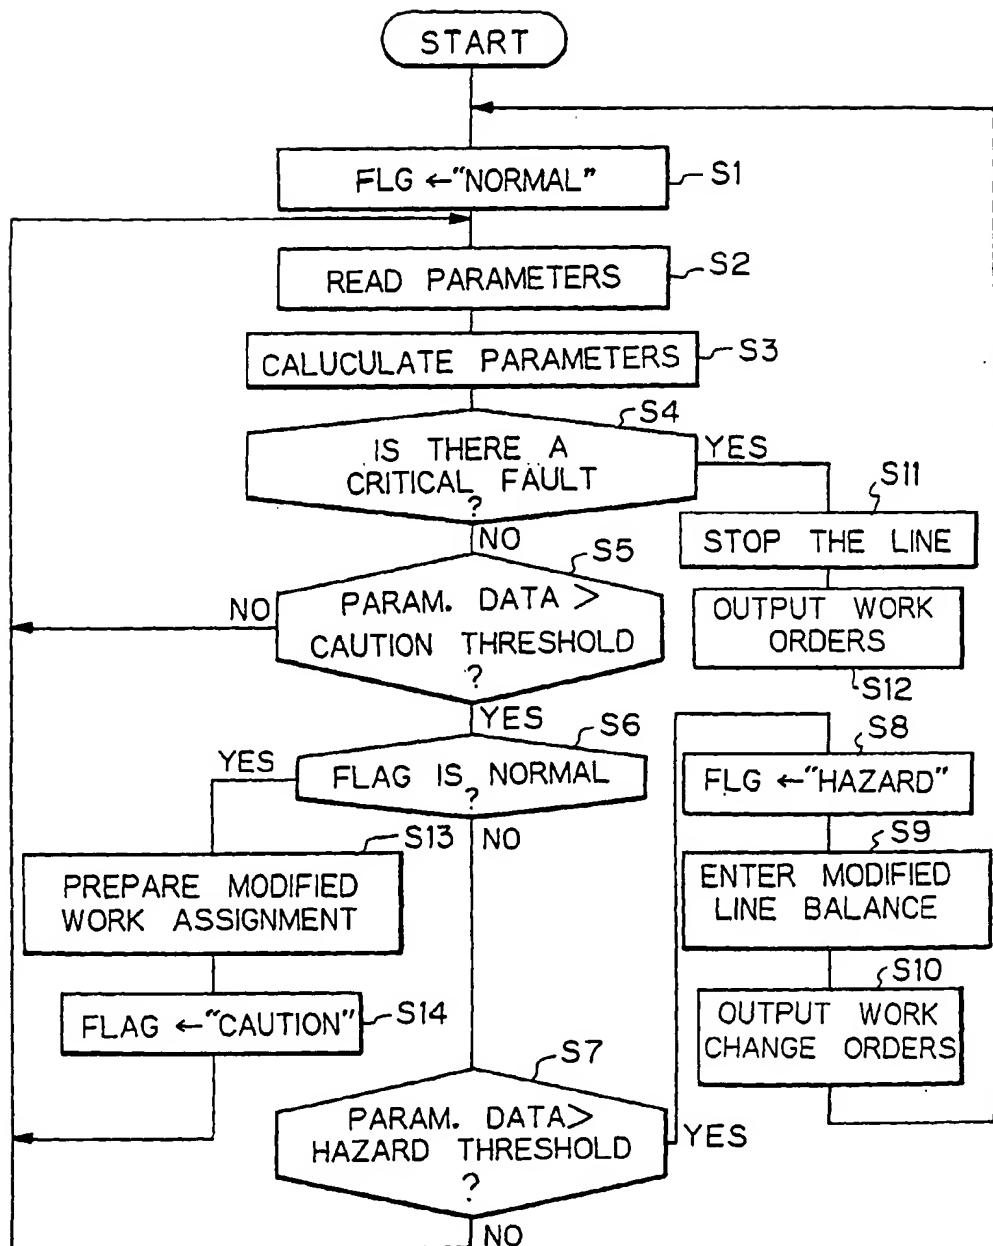


Fig. 6

| PROCESS | $n=21$ $m=3$ | GROUP SUM | MULTIPLY RATINGS | ASSIGN IMAGINARY PROCESS |
|-------------------------------------|--|-------------|-----------------------|---|
| PROCESS M1 RATING $R_1 = 110$ | $X_1=15$ $X_2=12$ $X_3=8$ $X_4=10$ $X_5=11$ $X_6=6$ | $A_1 = 6.2$ | $A_1 * 100/R_1 = 5.7$ | $A_1 * 100/R_1 + X_1, 5 + X_1, 6 + X_2, 0 = 75$ |
| PROCESS M2 RATING $R_2 = 80$ | $X_7=18$ $X_8=11$ $X_9=20$ | $A_2 = 4.9$ | $A_2 * 100/R_2 = 6.2$ | $A_2 * 100/R_2 + X_1, 8 + X_2, 1 = 75$ |
| PROCESS M3 RATING $R_3 = 95$ | $X_{10}=23$ $X_{11}=7$ $X_{12}=6$ $X_{13}=17$ $X_{14}=10$ | $A_3 = 6.3$ | $A_3 * 100/R_3 = 6.7$ | $A_3 * 100/R_3 + X_1, 7 + X_1, 9 = 75$ |
| IMAGINARY PROCESS WORKS | $X_{15}=9$ $X_{16}=6$ $X_{17}=4$ $X_{18}=7$ $X_{19}=4$ $X_{20}=3$ $X_{21}=6$ | | | LINE BALANCE LOSS MIN. ↑ |
| | | | | $X = 213$ |
| | | | | $A = 71$ |

Fig. 7

| | n=21 m=3 | GROUP SUM | MULTIPLY RATINGS | ASSIGN IMAGINARY PROCESS |
|--|--|---------------------|--|---|
| PROCESS M1 RATING R ₁ = 110 | X ₁ =15 X ₂ =12 X ₃ =8 X ₄ =10 X ₅ =11 X ₆ =6 | A ₁ = 62 | A ₁ * 100 / R ₁ = 57 | A ₁ * 100 / R ₁ + X ₁₅ + X ₁₆ + X ₂₁ = 78 |
| PROCESS M2 RATING R ₂ = 70 | X ₇ =18 X ₈ =11 X ₉ =20 | A ₂ = 49 | A ₂ * 100 / R ₂ = 70 | A ₂ * 100 / R ₂ + X ₁₇ + X ₁₉ = 78 |
| PROCESS M3 RATING R ₃ = 95 | X ₁₀ =23 X ₁₁ =7 X ₁₂ =6 X ₁₃ =17 X ₁₄ =10 | A ₃ = 63 | A ₃ * 100 / R ₃ = 67 | A ₃ * 100 / R ₃ + X ₁₈ + X ₂₀ = 77 |
| IMAGINARY PROCESS WORKS | X ₁₅ =9 X ₁₆ =6 X ₁₇ =4 X ₁₈ =7 X ₁₉ =4 X ₂₀ =3 X ₂₁ =6 | | | ↑ LINE BALANCE LOSS MIN. |
| | | X = 213 | A = 71 | |

Fig. 8A

Fig. 8A

Fig. 8B

WORK CONTENTS

| TYPE CODE | PRODUCT NAME | WORK NAME | WORK CONTENTS | ASMBL. PARTS | PREP. CLN HRS | MAN-HRS | WORK SEQUENCE |
|-----------|--------------|-----------|------------------|---------------------|---------------|-----------|---------------|
| | | | | CONTENTS PARTS NAME | FROM Q'tys | PREP. CLN | |
| 1 0 4 5 1 | α | X 1 | Asmb BASE A | BASE A | 1 | 1 5 | 1 |
| | | X 2 | BOLT BASE A | M 3X6 | — | 1 2 | 2 |
| | | X 3 | LABEL N. P. | NP ^a | 3 | 8 | 3 |
| | | X 4 | MOUNT M.FITTINGS | MF A | 1 | 1 0 | 4 |
| | | X 5 | BOLT M.FITTINGS | M 3X4 | 4 | 3 | 5 |
| | | X 6 | MOUNT P.S. UNIT | P.S. UNIT | — | 1 1 | 6 |
| | | X 7 | BOLT P.S. UNIT | M3X10 | 2 | 6 | 7 |
| | | X 8 | MOUNT FDD | FDD | 1 | 1 8 | 8 |
| | | X 9 | BOLT FDD | M 3X10 | 3 | 2 0 | 9 |
| | | X 10 | MOUNT Pt PLATE | Pt UNIT | 2 | 2 3 | 1 0 |
| | | X 11 | BOLT Pt PLATE | M 3X5 | — | 7 | 1 1 |

Fig. 8B

Fig. 9A

| OPERATOR ID | NAME | RATING |
|-------------|-----------------|--------|
| 3 8 4 7 2 | ICHIRO KANAZAWA | 110 |
| 1 7 4 6 2 | HANAKO ISHIKAWA | 80 |

Fig. 9B

| HIGH EFFICIENCY WORKING TIME | |
|---------------------------------|---------|
| START | END |
| 10 : 00 | 11 : 00 |
| 15 : 00 | 16 : 00 |

Fig. 9C

| TYPE CODE | PRO. SEQ. NO. |
|-----------|---------------|
| 1 0 4 5 1 | 1 |
| 0 2 3 4 2 | 1 |
| 4 8 2 3 1 | 1 |
| 8 7 3 5 4 | 2 |
| 3 7 2 3 9 | 2 |
| 7 4 3 2 9 | 2 |
| 4 3 7 8 4 | 2 |
| 6 8 7 2 4 | 3 |
| 5 2 4 3 8 | 3 |
| 3 2 7 6 4 | 3 |
| 6 4 3 2 6 | 4 |
| 6 2 3 2 8 | 4 |

Fig. 10A

| MAINTENANCE TOOL | STOCK QTYS |
|---------------------|------------|
| A | 10 |
| B | 8 |
| C | 15 |

Fig. 10B

| NAME | TYPE CODE MAINTENANCE TOOL | QTYS |
|----------|---|--|
| α | BASE A BOLT M3X6 N. M. α METAL F.A BOLT M3X4 P.S. BOLT M3X10 FDD UNIT BOLT M3X10 Pt BOARD BOLT M3X5 HD UNIT BOLT M3X12 UP COVER BOLT M3X4 BOLT M3X7 BOLT M3X3 BOLT M3X6 BOLT M3X7 MAINTE TOOL A | 1 3 1 1 2 1 2 3 2 1 2 1 2 3 2 1 1 1 1 1 |

Fig. 10C

| START DATE | TYPE CODE | PRODUCT NAME | QTYS | SCHEDULED DATE |
|---------------|-----------|-----------------|------|-------------------|
| 10.06.92 | 1 0 4 5 1 | α | 1 0 | 10.08.92 |
| 10.06.92 | 7 4 3 2 9 | β | 6 | 10.07.92 |
| 10.06.92 | 6 4 3 2 6 | γ | 2 0 | 10.09.92 |

Fig. 1 1A

PROCESS BASE FILE

| PROCESS | PROD. NAME | QTYs | WORK DATE & TIME | TACT PITCH | WORKS |
|---------|------------|------|------------------|------------|--|
| M 1 | α | 10 | 10.06.92/08:40 | 7 5 | X 1 X 2 X 3 X 4 X 5 X 6 X 15 X 16 X 20 |
| M 2 | α | 10 | 10.06.92/08:42 | 7 5 | X 7 X 8 X 9 X 18 X 21 |
| M 3 | α | 10 | 10.06.92/08:44 | 7 5 | X 10 X 11 X 12 X 13 X 14 X 17 X 19 |
| : | : | : | : | : | : |

Fig. 1 1B

SCHEDULE FILE

| WORK START DATE | TYPE & CODE | PRODUCT NAME | QTYs | PRODUCTION SEQUENCE NUMBER | WORK STARK TIME FOR M1 |
|-----------------|-------------|--------------|------|----------------------------|------------------------|
| 10.06.92 | 1 0 4 5 1 | α | 10 | 1 | 0 8 : 4 0 |
| 10.06.92 | 7 4 3 2 9 | β | 6 | 2 | 0 8 : 5 3 |
| 10.06.92 | 6 4 3 2 6 | γ | 20 | 3 | 0 9 : 1 2 |

Fig. 12

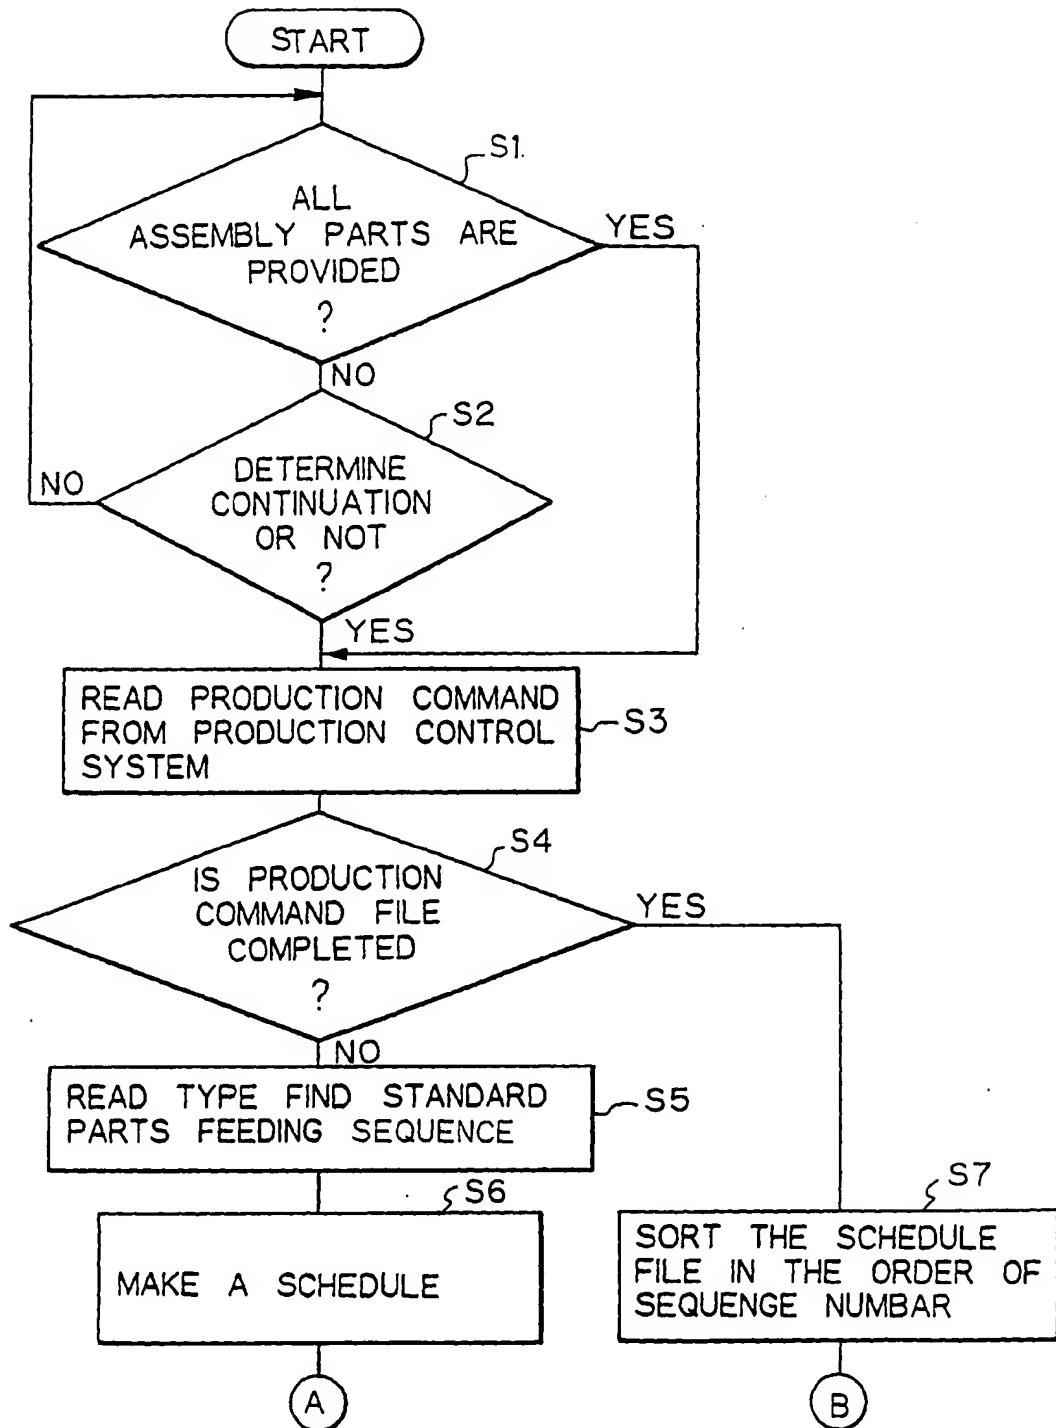


Fig. 13


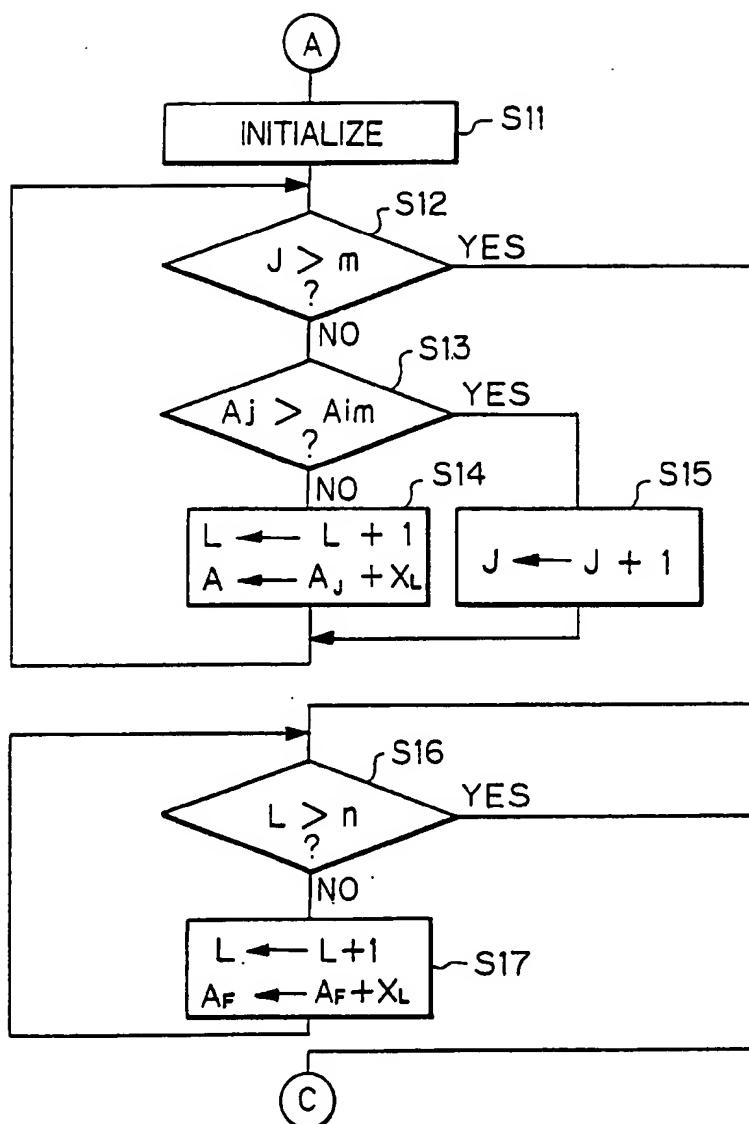


Fig. 14

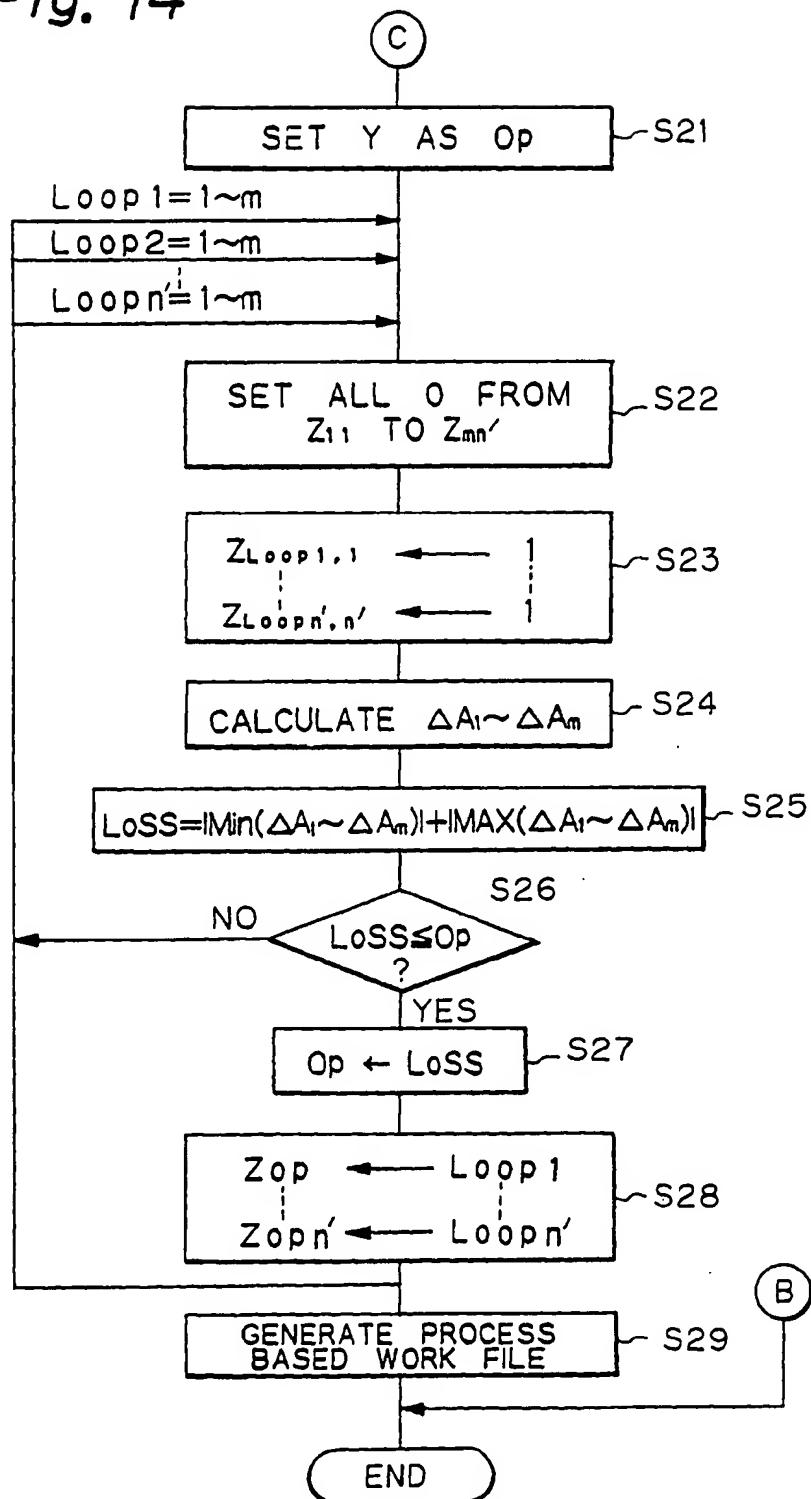

$n=21$
 $m=3$

Fig. 15

EP 0 600 146 B1

| | GROUP SUM | MULTIPLY RATINGS | ASSIGN IMAGINARY PROCESS |
|-------------------------------------|--|-------------------------|--|
| PROCESS M1 RATING $R_1 = 110$ | $X_1 = 15$ $X_2 = 12$ $X_3 = 8$ $X_4 = 10$ $X_5 = 11$ $X_6 = 6$ | $A_1 = 62$ | $A_1 \times 100 / R_1 = 57$ $+ X_{20} = 75$ |
| PROCESS M2 RATING $R_2 = 80$ | $X_7 = 18$ $X_8 = 11$ $X_9 = 20$ | $A_2 = 49$ | $A_2 \times 100 / R_2 = 62$ $= 75$ |
| PROCESS M3 RATING $R_3 = 95$ | $X_{10} = 23$ $X_{11} = 7$ $X_{12} = 6$ $X_{13} = 17$ $X_{14} = 10$ | $A_3 = 63$ | $A_3 \times 100 / R_3 = 67$ $= 75$ |
| IMAGINARY PROCESS WORKS | $X_{15} = 9$ $X_{16} = 6$ $X_{17} = 4$ $X_{18} = 7$ $X_{19} = 4$ $X_{20} = 3$ $X_{21} = 6$ | | |
| | | | \uparrow LINE BALANCE LOSS MIN. |
| | | $X = 213$ $Aim = 71$ | |

Fig. 16

n=18
m=3

| | GROUP SUM | MULTIPLY RATINGS | ASSIGN IMAGINARY PROCESS |
|--|---|---------------------|--|
| PROCESS M1 RATING R ₁ = 110 | X ₁ = 15 X ₂ = 12 X ₃ = 8 X ₄ = 10 X ₅ = 11 X ₆ = 6 X ₇ = 18 | A ₁ = 80 | A ₁ 100/R ₁ = 72.7 72.7 + X ₂ = 75.7 |
| PROCESS M2 RATING R ₂ = 80 | X ₈ = 11 X ₉ = 20 X ₁₀ = 23 | A ₂ = 54 | A ₂ 100/R ₂ = 67.5 67.5 + X ₂ = 73.5 |
| PROCESS M3 RATING R ₃ = 95 | X ₁₁ = 7 X ₁₂ = 6 X ₁₃ = 17 X ₁₄ = 10 X ₁₅ = 9 X ₁₆ = 6 X ₁₇ = 4 X ₁₈ = 7 X ₁₉ = 4 | A ₃ = 70 | A ₃ 100/R ₃ = 73.7 73.7 |
| IMAGINARY PROCESS WORKS | X ₂₀ = 3 X ₂₁ = 6 | | |

↑ LINE BALANCE
LOSS MIN.

X = 213
A_{i1} = 82.2
A_{i2} = 59.8
A_{i3} = 71

Fig. 17A

Fig. 17

| |
|----------|
| Fig. 17A |
| Fig. 17B |

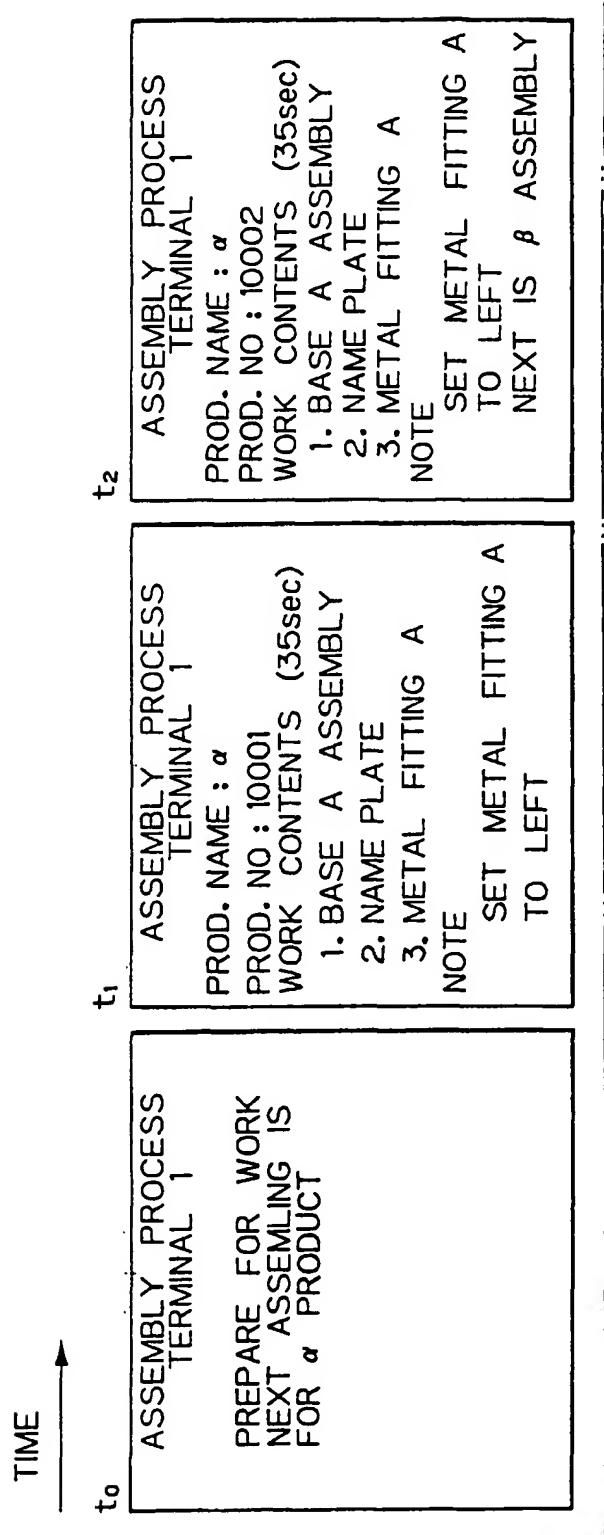


Fig. 17B

| | | |
|--|--|--|
| t ₃ | t ₄ | t ₅ |
| <p>ASSEMBLY PROCESS TERMINAL 1</p> <p>PROD. NAME : β PROD. NO : 851 WORK CONTENTS (18sec) 1. BASE B ASSEMBLY 2. P.S. BOLTS NOTE</p> | <p>ASSEMBLY PROCESS TERMINAL 1</p> <p>PROD. NAME : β PROD. NO : 852 WORK CONTENTS (18sec) 1. BASE B ASSEMBLY 2. P.S. BOLTS NOTE</p> | <p>ASSEMBLY PROCESS TERMINAL 1</p> <p>NO MORE WORK TODAY</p> |

Fig. 18A [FAULT INFORMATION TERMINAL]

TYPE LT30 J1S G EH PARTS NO. 000401
 PRODUCT NO. 50372

TEST 00: PRIMITIVE 01: AGING 02: FINAL 00.
 TEMP. 00: NORM. T 01: NORM. T 02: HI TEMP. 00
 VOLT 00: NORM. 01: -10% 02: +10% 00
 IMPULSE 00: NO 01: YES 02: OTHERS 00

Fig. 18B [FAULT INFORMATION TERMINAL]

TYPE PF7900B222C(P) PARTS NO 000002
 PRODUCT NO.

TEST 00 TEMP 00 VOLT 00 IMPULSE 00
 OCCURRENCE 00: NORM 01: INTMIT 06: REOCCUR 01
 PHENOMENON CODE 423 REQUEST 11 NAME JACK
 PROG. NAME
 FAULT CONTENT
 LINES ON SCREEN

Fig. 19A

| [FAULT INFORMATION TERMINAL] (CONFIRM NO.) | | TYPE: LT30/JIS G BH | PRODUCT NO.: 50372 | SEP. 28, 92 |
|---|-----------|----------------------|--------------------|-------------|
| | 000401 | | | |
| No. | PROD NAME | LOT NO. | PARTS NO. | Y/N |
| 01 | LT SYS1H | 03P | 280050 | |
| 02 | LT BP1 | 01A | 1X0001 | |
| 03 | PWR116A | 04D | 12941 | |
| 04 | KB(JIS) | 11D | H714215T | |
| 05 | LCD | 14A | 17615 | |
| 06 | 3.5FPD | A6 | 20280417 | NG |
| 07 | 3.5DISK | 135M | A8 | 0032050 |
| 08 | | | | |
| 09 | | | | |
| 10 | | | | |
| 11 | | | | |
| | | | | |
| 20 | | | | |
| 99 | OTHERS | (SURFACE IS DAMAGED) | | |

Fig. 19B

[FAULT INFORMATION TERMINAL] TYPE: LT30/JIS G BH PRODUCT NO.: 50372 SEP. 28, 92

| (CONFIRM NO.) | 000401 | LOT NO. | PARTS NO. | Y/N |
|---------------|-----------------------------|---------|-----------|-----|
| No. | PROD NAME | | | |
| 01 | LT SYS1H | 03P | 280050 | |
| 02 | LT BP1 | 01A | 1X0001 | |
| 03 | PWR116A | 04D | 12941 | |
| 04 | KB(JIS) | 11D | H714215T | |
| 05 | LCD | 14A | 17615 | |
| 06 | 3.5FPD | A6 | 20280417 | |
| 07 | 3.5DISK 135M | A8 | 0032050 | |
| 08 | | | | |
| ... | | | | |
| 20 | | | | |
| 99 | OTHERS (SURFACE IS DAMAGED) | | | |